



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	50381
Work Order #	50381
Service Date	02/21/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	821
Caller	Contract

Location	Customer
ANN MULL2 Ann A.Mullen Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
School has no heat

Unit #:	Description:
Make:	Serial#:
Work Performed: JCI Found all Loop Pumps that were enabled were only running at minimum speed, 18Hz. Control system was not commanding pumps to speed up. In the controllers points list, the DP sensors as well as pump speed commands are showing as offline. JCI must investigate why pumps are not being commanded to speed up. Until JCI comes out, I put all pumps in Hand mode and set to 90% speed to get HW flow through building.	

Recommendations

Summary					
Materials					
N/A					
Labor					
Technician	Hours				
David Dougherty	Reg Labor	2.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	50378
Work Order #	50378
Service Date	02/21/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	838
Caller	Contract

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Classroom 120 has no heat

Unit #:	Description:
Make:	Serial#:
Work Performed: JCI -Classroom 120 has no heat. Teacher is complaining fan does not run. When I arrived I found the fan was running and heating the room. Found the thermostat is holding the fan out from running at periods throughout the day. NAE is offline so I am unable to see points list of controller. JCI must come out and investigate.	

Recommendations

Summary					
Materials					
N/A					
Labor					
Technician	Hours				
David Dougherty	Reg Labor	1.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	50372
Work Order #	50372
Service Date	02/21/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	750
Caller	Sani Umar

Location	Customer
GLENLAND Glen Landing Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
PROGRAMMING

Unit #:	Description:
Make:	Serial#:
Work Performed: Integrated HW pump speed command points as well as differential pressure readings into NAE for Dave D. to troubleshoot.	

Recommendations

Summary					
Materials					
Labor					
Technician	Hours				
Stephen Suboleski	Reg Labor	0.50	O/T Labor	0.00	Prem
					0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 50273

Work Order #: 50273

Service Date: 02/20/2020

Ticket Type: Ctl's T&M

Category: ATC T&M Service

Job#: 738

Caller: Sani Umar

Location	Customer
CHARLES Charles W. Lewis Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Library has no heat

Unit #:	Description:
Make:	Serial#:
Work Performed: -Library has no heat. Upon troubleshooting, found the HW control valve actuator is driving backwards. Reversed rotation and verified DA temp went up. All tankless water heaters are operating as they should -Attended JCI meeting.	

Recommendations

Summary						
Materials						
N/A						
Labor						
Technician	Hours					
David Dougherty	Reg Labor	5.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70

Medford, NJ 08055

Tel: (609) 714-3699 Fax: (609) 714-3698

Email: service@petersonservice.com

Service Ticket #: 50272

Work Order #: 50272

Service Date: 02/20/2020

Ticket Type: Ctl's T&M

Category: ATC T&M Service

Job#: 821

Caller: Sani Umar

Location

ANN MULL2
Ann A. Mullen Middle School

Customer

Gloucester Twp. Public Schools
17 Erial Rd.
Blackwood, NJ 08012

Work Requested

Guidance Office has no heat

Unit #:

Description:

Make:

Serial#:

Work Performed:

Upon troubleshooting, found motor is not running due to bad capacitor. Picked up new capacitor and installed. Verified operation.

Recommendations

Summary

Materials

PO 11583

Labor

Technician

Hours

David Dougherty

Reg Labor

3.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	50115
Work Order #	48516
Service Date	02/25/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2394
Caller	Sani Umar

Location	Customer
CHEWS EL Chews Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Follow up on Ticket #48665
Follow up on Ticket #48516
investigate room 302 heat issues

Unit #:

Description:

Make:

Serial#:

Work Performed:

cut out bad piping and unions. soldered new connections. fix additional leaks. leak tested and operated unit. satisfactory at this time.

Recommendations

Summary

Materials

PO 11601, fittings.

Labor

Technician	Hours				
	Reg Labor	O/T Labor	Prem		
David Birkey	8.00	0.00		0.00	

Customer Signature

[Handwritten Signature]

Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	50019
Work Order #	49901
Service Date	03/06/2020
Ticket Type	Ctls T&M
Category	ATC T&M Service
Job#	639
Caller	Sani Umar

Location	Customer
UNION VA Union Valley Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Follow up on Ticket #49955 Follow up on Ticket #49901 Replace controller for FCU-10

Unit #:	Description:
Make:	Serial#:
Work Performed: Picked up valve body and installed in AHU. Tested and verified operation.	

Recommendations

Summary

Materials

Original ticket has PO that valve was ordered under

Labor

Technician	Hours			
	Reg Labor	O/T Labor	Prem	
David Dougherty	3.00	0.00	0.00	0.00

Customer Signature

Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	50012
Work Order #	49901
Service Date	02/18/2020
Ticket Type	Ctls T&M
Category	ATC T&M Service
Job#	639
Caller	Sani Umar

Location	Customer
UNION VA Union Valley Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Follow up on Ticket #50010 Follow up on Ticket #49901 Replace controller for FCU-10 Wrote program for replacement FCU-10 controller. Need to fix database points/graphics for slightly changed control points.

Unit #:	Description:
Make:	Serial#:
Work Performed: Fixed database/graphics.	

Recommendations

Summary					
Materials					
Labor					
Technician	Hours				
	Reg Labor	O/T Labor	Prem		
Stephen Suboleski	0.50	0.00			0.0

Customer Signature

Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 50010

Work Order #: 49901

Service Date: 02/14/2020

Ticket Type: Ctl's T&M

Category: ATC T&M Service

Job#: 639

Caller: Sani Umar

Location

UNION VA
Union Valley Elementary School

Customer

Gloucester Twp. Public Schools
17 Erial Rd.
Blackwood, NJ 08012

Work Requested

Follow up on Ticket #49901 Replace controller for FCU-10

Unit #: _____ Description: _____
Make: _____ Serial#: _____

Work Performed:

Wrote program for replacement FCU-10 controller. Need to fix database points/graphics for slightly changed control points.

Recommendations

Summary

Materials

Labor

Technician

Stephen Suboleski

Hours

Reg Labor	O/T Labor	Prem	0.00
1.00	0.00		

Customer Signature

nted Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	49956
Work Order #	49956
Service Date	02/13/2020
Ticket Type	Ctls T&M
Category	ATC T&M Service
Job#	750
Caller	Contract

Location	Customer
GLENLAND Glen Landing Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Troubleshoot Rm. 202 controller offline

Unit #:	Description:
Make:	Serial#:
Work Performed: Controller is offline because of no power to unit. Found breaker turned off. Breaker was turned off by facilities because they could not get motor to run. Upon troubleshooting, found the motor was not wired correctly and was missing a jumper. Disconnected motor and rotated so it could be accessed. Installed jumper wire and tested motor. Motor ran. Reinstalled motor. Upon start up, blower housing was shaking excessively. Found the the backing plate that the fan housings are riveted to is cracked and is allowing the metal to flex as the unit runs. Without welding plate, I do not see this as fixable. Recommend either abandoning unit in place or removing from ceiling and installed ductless split system in classroom.	

Recommendations

Summary					
Materials					
N/A					
Labor					
Technician	Hours				
David Dougherty	Reg Labor	4.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	49955
Work Order #	49901
Service Date	02/14/2020
Ticket Type	Ctls T&M
Category	ATC T&M Service
Job#	639
Caller	Sani Umar

Location	Customer
UNION VA Union Valley Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Follow up on Ticket #49901 Replace controller for FCU-10

Unit #:	Description:
Make:	Serial#:
Work Performed: Picked up enclosure and mounted. Ran wires into controller and mounted new controller. Wired up controller. Downloaded program and commissioned. The OA damper has a short and is preventing the HW valve from operating. Disconnected actuator until a replacement can be installed. While commissioning, found the HW valve stem disconnected from the actuator several times. Upon further inspection, found the valve stem threads are stripped. Entire valve body must be replaced. Must return to install new valve body and actuator.	

Recommendations

Summary					
Materials					
PO 11547					
Labor					
Technician	Hours				
David Dougherty	Reg Labor	8.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	49901
Work Order #	49901
Service Date	02/13/2020
Ticket Type	Cils T&M
Category	ATC T&M Service
Job#	639
Caller	Sani Umar

Location	Customer
UNION VA Union Valley Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Replace controller for FCU-10

Unit #:	Description:
Make:	Serial#:
Work Performed: Controller is powered up but is not communicating. Controller is bad and must be replaced. Began disconnecting terminals. Because this controller has extra inputs and outputs for radiation and OA damper, it requires the bigger PCG controller. Picked up PCG controllers and sensors. The controller does not fit in the existing enclosure. Ordered bigger inclosure. Once enclosure is installed, I can install the new controller and wire up.	

Recommendations

Summary					
Materials					
PO 11532					
Labor					
Technician	Hours				
David Dougherty	Reg Labor	4.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 49693	
Work Order #	49683
Service Date	02/07/2020
Ticket Type	CtIs T&M
Category	ATC T&M Service
Job#	738
Caller	Contract

Location	Customer
CHARLES Charles W. Lewis Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Continue tracing out power for FCU's in 100 Wing

Unit #:	Description:
Make:	Serial#:
Work Performed: -Continued tracing out power for FCU's in 100 Wing. Found PE switch above breaker panel. When breaker panel cover was removed, found there was a contactor behind the cover. When the contactor is called to enable, power is supplied to that grouping of FCU's. Found 2 more additional panels that feed the remaining FCU's. Found the occupied/unoccupied/auto switch for classroom FCU's in the boiler room was set to unoccupied. This was supplying air to the PE switches and disabling the contactors. Once placed in auto, the contactors pulled in and the FCU blowers enabled and ran as they should. -Met for JCI Meeting.	

Recommendations

Summary						
Materials						
N/A						
Labor						
Technician	Hours					
David Dougherty	Reg Labor	8.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	49683
Work Order #	49683
Service Date	02/06/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	738
Caller	Contract

Location	Customer
CHARLES Charles W. Lewis Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Troubleshoot no power to 100 Wing FCU's

Unit #:	Description:
Make:	Serial#:
Work Performed: - Was supposed to meet with Ray from JCI but I never heard from him/never showed - Began troubleshooting no power to 100 Wing FCU's. Looked through blueprints and found the lightening panel that feeds some of the FCU's but still must locate the PE switch. Picked up Tracer to trace wiring. - Troubleshoot FCU for Latchkey. Found the electric heat is not working. Suspect heater is burned up. Must remove unit and disassemble. Troubleshoot old FCU that was removed. Both stages of electric heat as well as the mechanical heat are operating as it should. I suspect the low ambient switch is preventing the mechanical heat from disengaging on cold days, which as a result prevents the second stage from running. Recommend replacing low ambient switch in case it is out of calibration.	

Recommendations

Summary						
Materials						
Cash receipt submitted for purchase at Lowe's						
Labor						
Technician	Hours					
David Dougherty	Reg Labor	6.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	49682
Work Order #	49682
Service Date	02/06/2020
Ticket Type	CtIs T&M
Category	ATC T&M Service
Job#	750
Caller	Contract

Location	Customer
GLENLAND Glen Landing Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Troubleshoot BAS network down

Unit #:	Description:
Make:	Serial#:
Work Performed: Troubleshoot BAS network down. Found comcast modem has been reset and DMZ setting was disabled. Enabled DMZ and set accordingly. Pinged all 3 N30's remotely. Network is back up and running. Verified cameras could be seen	

Recommendations

Summary					
Materials					
N/A					
Labor					
Technician	Hours				
David Dougherty	Reg Labor	2.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:		49358
Work Order #		49358
Service Date		01/27/2020
Ticket Type		CtIs T&M
Category		ATC T&M Service
Job#		738
Caller		Sani Umar

Location	Customer
CHARLES Charles W. Lewis Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Stage Area overheating.

Unit #:	Description:
Make:	Serial#:
Work Performed: Troubleshoot Stage area overheating. Replaced pneumatic controls. Met to discuss Johnson Controls project.	

Recommendations

Summary					
Materials					
Labor					
Technician	Hours				
David Dougherty	Reg Labor	8.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 49354

Work Order # 49354

Service Date 01/29/2020

Ticket Type Ctl's T&M

Category ATC T&M Service

Job# 750

Caller Sani Umar

Location

GLENLAND
Glen Landing Middle School

Customer

Gloucester Twp. Public Schools
17 Erial Rd.
Blackwood, NJ 08012

Work Requested

Troubleshoot BAS network down.

Unit #:

Description:

Make:

Serial#:

Work Performed:

Troubleshoot network issues.

Recommendations

Summary

Materials

Labor

Technician

David Dougherty

Hours

Reg Labor

6.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name:



Peterson

Service Company

234 Route 70

Medford, NJ 08055

Tel: (609) 714-3699 Fax: (609) 714-3698

Email: service@petersonservice.com

Service Ticket #: 49346	
Work Order #	49346
Service Date	01/29/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	1141
Caller	Sani Umar

Location	Customer
CHARLES Charles W. Lewis Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Boiler having an issue

Unit #: BLR2	Description: Boiler 2
Make:	Serial#:
Work Performed: Checked all controls and gas pressures. Checked and set igniter and transformer. Checked sensor signal and flame sensor. Checked Honeywell control. Found flame guard sensor loose. Secured and checked.	

Recommendations

Summary						
Materials						
none						
Labor						
Technician	Hours					
Carl Beier	Reg Labor	4.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:		49089
Work Order #		49089
Service Date		02/04/2020
Ticket Type		Serv T&M
Category		HVAC T&M Service
Job#		722
Caller		Sani Umar

Location	Customer
UNION VA Union Valley Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Per Dave Birkey: Boiler 1B, is having intermittent *internal Fault* code 35 and airflow switch failure. IF YOU HAVE ANY QUESTIONS CONTACT DAVE BIRKEY

Unit #: BLR2	Description: BOILER 2
Make:	Serial#:
Work Performed: cleaned and checked air pressure switch. checked controls and gas pressures. checked igniter and sensor. performed combustion analysis. (boiler 1b) checked operation of boiler 1a. checked sensor and signal. adjusted gas pressure and flame. performed combustion analysis.	

Recommendations
recommend replacement of gas valve and either regulator spring or regulator and perform combustion test after replacement. (boiler 1a) part numbers are in pictures.

Summary					
Materials					
none					
Labor					
Technician	Hours				
Carl Beier	Reg Labor	8.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70

Medford, NJ 08055

Tel: (609) 714-3699 Fax: (609) 714-3698

Email: service@petersonservice.com

Service Ticket #: 49088

Work Order # 49088

Service Date 01/27/2020

Ticket Type Serv T&M

Category HVAC T&M Service

Job# 1141

Caller Sani Umar

Location

CHARLES

Charles W. Lewis Middle School

Customer

Gloucester Twp. Public Schools

17 Erial Rd.

Blackwood, NJ 08012

Work Requested

Per Dave Birkey: Boiler #2 (right side) is continuing to go into alarm for pilot. Bob looked at it a few times and its continuing to have issue.

Unit #:

Description:

Make:

Serial#:

Work Performed:

Boiler in operation on arrival, checked pilot and main burner gas pressures. Main regulator adjustments are not working, standing pressure stays at 21" WC, no matter how the spring is adjusted. Burner book says standard max. pressure is 14" WC., but consulting to burner spec. sheet it can be as high as 28" WC. Manifold pressure is right at specifications 3.5" WC. Performing combustion test the burner ran very high CO readings at low fire. Adjusted fuel /air ratio till the same reading were attained during all firing rates. Left system in operation

Recommendations

Summary

Materials

combustion analyzer

Labor

Technician

Hours

Patrick Duffy

Reg Labor

8.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name:

Master HVAC/R Contractor: Renee Fiorelli



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 49077	
Work Order #	49077
Service Date	01/24/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	722
Caller	Sani Umar

Location	Customer
UNION VA Union Valley Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Un-Resolved by LAKISHA SPAKOSKY on 1/24/2020 02:10 PM investigate boiler operation

Unit #:	Description:
Make:	Serial#:
Work Performed: Resolution: at time of arrival, boiler 2 is running and maintaining 160 degree water at around 20psi system pressure. boiler 1 is not cutting in on automatic alternating sequence due to motor controller in fault. over amperage occurred at some point and the controller shut down. Reset fault and pump for boiler 1 is operating. boiler 1 fired normal. system water temp values are such: OA >40 = 180 degree water temp OA <60 = 140 degree water temp current OA 45 with 170degree water temp. boilers are set to 160 degrees causing both boilers to come online to reach a satisfactory set point. lowered >40 value to 170. -original issue is boiler 2 has gone into alarm 2 times in 2 days. unknown cause for alarm condition as the unit was reset prior to my arrival.	

Recommendations

Summary					
Materials					
Labor					
Technician	Hours				
David Birkey	Reg Labor	8.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Email: service@petersonservice.com

Service Ticket #:	49077
Work Order #	49077
Service Date	01/24/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	722
Caller	Sani Umar

Location	Customer
UNION VA Union Valley Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Unit #:	Description:
Make:	Serial#:
will contact office and have additional tech support at later date.	

Recommendations

Summary					
Materials					
Labor					
Technician	Hours				
	Reg Labor		O/T Labor		Prem

Customer Signature

2024

Printed Name:

Master HVAC/R Contractor: Renee Sicelli

Page 2 of 2



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 49037

Work Order #: 48920

Service Date: 01/27/2020

Ticket Type: Serv T&M

Category: HVAC T&M Service

Job#: 2004

Caller: Sani Umar

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Follow up on Ticket #48920 investigate over heating in room 112

Unit #:

Description:

Make:

Serial#:

Work Performed:

Found condition in room 112 to be malfunctioning P E switch and air leaks from dampers and other controls. Also noted a presence of moisture in pneumatic lines causing erratic behavior of unit. Corrected PE switch by calibrating air pressure from tstat to fan control. Replaced numerous pneumatic fittings which had corroded. Operation satisfactory at this time.

Recommendations

Summary

Materials

pneumatic fittings, PO 11314.

Labor

Technician

Hours

David Birkey

Reg Labor

8.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 49009	
Work Order #	49009
Service Date	01/21/2020
Ticket Type	Cils T&M
Category	ATC T&M Service
Job#	750
Caller	Contract

Location	Customer
GLENLAND Glen Landing Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Network is down for HVAC system

Unit #:	Description:
Make:	Serial#:
Work Performed: Network is down. Found settings in Comcast Modem had been changed by Atech. Contacted them and discussed a potential resolution to prevent this from happening again. Worked with Steve to switch modem configuration back to the way it was. Verified BAS could be seen remotely and cameras could be seen internally.	

Recommendations

Summary						
Materials						
N/A						
Labor						
Technician	Hours					
David Dougherty	Reg Labor	1.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48985	
Work Order #	48869
Service Date	01/23/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2004
Caller	Sani Umar

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Follow up on Ticket #48913 Follow up on Ticket #48869 room 209, investigate unit operation unit fan operating with no termination at set point. determined Pneumatic Electrical switch is no functioning correctly. obtained new

Unit #:	Description:
Make:	Serial#:
Work Performed: corrected Pneumatic Electrical switch malfunction by replacing old mechanism. set pressures to be congruent with fan off on a satisfied set point.	

Recommendations

Summary						
Materials						
PO 11301, pneumatic switch.						
Labor						
Technician	Hours					
David Birkey	Reg Labor	4.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48920
Work Order #	48920
Service Date	01/23/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2004
Caller	Sani Umar

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
investigate over heating in room 112

Unit #:	Description:
Make:	Serial#:
Work Performed: found numerous air leaks and misaligned tubing to properly control unit via tstat. will return with fittings to correct controls and set pressure ratings.	

Recommendations

Summary					
Materials					
00					
Labor					
Technician	Hours				
David Birkey	Reg Labor	4.00	O/T Labor	0.00	Prem
					0.00

Customer Signature
Printed Name:
Master HVAC/R Contractor: Renee Fiorelli



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48913
Work Order #	48869
Service Date	01/22/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2004
Caller	Sani Umar

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Follow up on Ticket #48869 room 209, investigate unit operation

Unit #:	Description:
Make:	Serial#:
Work Performed: unit fan operating with no termination at set point. determined Pneumatic Electrical switch is no functioning correctly. obtained new switch and will return to install.	

Recommendations

Summary					
Materials					
00					
Labor					
Technician	Hours				
David Birkey	Reg Labor	5.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48910
Work Order #	48910
Service Date	01/21/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	1177
Caller	Sani Umar

Location	Customer
ERIAL EL Erial Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
investigate room D3 no heat

Unit #:	Description:
Make:	Serial#:
Work Performed: found unit zone valve functioning. blower operates. return air damper in closed position. opened damper and verified unit heat output. operation satisfactory at this time.	

Recommendations

Summary					
Materials					
00					
Labor					
Technician	Hours				
David Birkey	Reg Labor	3.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48869
Work Order #	48869
Service Date	01/21/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2004
Caller	Sani Umar

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
room 209, investigate unit operation

Unit #:	Description:
Make:	Serial#:
Work Performed: Found unit motor not operating. changed motor, bearing and shaft coupling. cleaned blower compartment. operation of motor satisfactory. unit control through tstat. is still an issue. will return to complete repairs.	

Recommendations

Summary					
Materials					
PO 11288, Tri State. motor, bearing and coupling.					
Labor					
Technician	Hours				
David Birkey	Reg Labor	5.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48850	
Work Order #	48850
Service Date	01/20/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	1336
Caller	Sani Umar

Location	Customer
ANN MULL2 Ann A.Mullen Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
clean coils in FCUs

Unit #:	Description:
Make:	Serial#:
Work Performed: cleaned FCU coils. Units are suspended in hallway ceiling. accessed filter section. brushed and vacuumed units for rooms 831, 833, 829 and 830. restored power and verified operation satisfactory at this time.	

Recommendations

Summary					
Materials					
00					
Labor					
Technician	Hours				
David Birkey	Reg Labor	4.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70

Medford, NJ 08055

Tel: (609) 714-3699 Fax: (609) 714-3698

Email: service@petersonservice.com

Service Ticket #: 48845

Work Order #: 48785

Service Date: 05/21/2020

Ticket Type: Serv T&M

Category: HVAC T&M Service

Job#: 2315

Caller: Sani Umar

Location

GLENDORA
Glendora Elementary School

Customer

Gloucester Twp. Public Schools
17 Erial Rd.
Blackwood, NJ 08012

Work Requested

Follow up on Ticket #48785
investigate no heat in room 18
unit zone valve is stuck in closed position. disassembled valve and manually opened. notified facilities of condition. will order new valve.

Unit #:

Description:

Make:

Serial#:

Work Performed:

retrieved materials from supply house and delivered to site. disassembled unit and located isolation valves. prepped area for installation.
Will return to continue install of new zone valve.

Recommendations

Summary

Materials

PO 12135 zone valve.

Labor

Technician

Hours

David Birkey

Reg Labor

2.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48822	
Work Order #	48822
Service Date	01/17/2020
Ticket Type	Cils T&M
Category	ATC T&M Service
Job#	738
Caller	Contract

Location	Customer
CHARLES Charles W. Lewis Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Troubleshoot no heat/power for FCU's in 200 wing

Unit #:	Description:
Make:	Serial#:
Work Performed: -Met with Johnson Controls to go over issues at Glen Landing as well as Loring Fleming -Worked with Trey and Bill to troubleshoot no power to FCU's in 200 wing. They will be returning to continue troubleshooting. -Installed HOA RIB relay of Boiler #3. Tested and verified operation	

Recommendations

Summary						
Materials						
Customer Stock						
Labor						
Technician	Hours					
David Dougherty	Reg Labor	6.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48815
Work Order #	48626
Service Date	01/16/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	1923
Caller	Contract

Location	Customer
ANN MULL2 Ann A.Mullen Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Worked with Comcast Tech Support to get BAS back online

Unit #:	Description:
Make:	Serial#:
Work Performed: Added DMZ and IP settings back into Comcast router and regained connectivity to the N30s through the N4 server.	
	

Recommendations

Summary						
Materials						
Labor						
Technician	Hours					
Stephen Suboleski	Reg Labor	1.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48785
Work Order #	48785
Service Date	01/17/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2315
Caller	Sani Umar

Location	Customer
GLENDORA Glendora Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
investigate no heat in room 18

Unit #:	Description:
Make:	Serial#:
Work Performed: unit zone valve is stuck in closed position. disassembled valve and manually opened. notified facilities of condition. will order new valve.	

Recommendations

Summary						
Materials						
00						
Labor						
Technician	Hours					
David Birkey	Reg Labor	3.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48761

Work Order #	48757
Service Date	01/17/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	838
Caller	Contract

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Follow up on Ticket #48757 Troubleshoot overheating in Gym

Unit #:	Description:
Make:	Serial#:
Work Performed: Unit was continuing to overheat even though heating relay was disabled. Found that inside the unit there are several capillary bulb thermostats, one of which was enabling the heat. Rewired the heating relay prior to all of these so that if the RIB relay contacts are open, there is no other way for the heat to run. Tested and verified operation.	
	

Recommendations

--

Summary

Materials

N/A

Labor

Technician

David Dougherty

Hours

Reg Labor

2.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name:

Master HVAC/R Contractor: Renee Fiorelli

Page 1 of 1

Master HVAC/R Contractor Lic#: 19HC00380500



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48757	
Work Order #	48757
Service Date	01/16/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	838
Caller	Contract

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Troubleshoot overheating in Gym

Unit #:	Description:
Make:	Serial#:
Work Performed: Worked with Dave B. to troubleshoot the Reznor unit for the Gym. Found that the enable relay was spliced in series with the Reznor Selectra temperature dial. The dial is an ohm sensor, not an open closed switch. Found in the manual that when this circuit is open/sensor goes bad, the heat is enabled. So when the heat RIB relay was energized, it was breaking ohm reading causing the unit to think the sensor was bad. This then caused the unit to run in heating mode. When the heat RIB relay was de-energized/satisfied, the selectra dial was then in play causing the unit to run to make the discharge air setpoint of the dial. We ran a new wire up to the roof and spliced the RIB relay into the room thermostat override contacts. Monitored operation. Must return to check operation	
	

Recommendations

Summary						
Materials						
N/A						
Labor						
Technician	Hours					
David Dougherty	Reg Labor	4.00	O/T Labor	0.00	Prem	0.00
Customer Signature						
Printed Name:						



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48756
Work Order #	48756
Service Date	01/16/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	821
Caller	Contract

Location	Customer
ANN MULL2 Ann A.Mullen Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Worked with Comcast Tech Support to get BAS back online

Unit #:	Description:
Make:	Serial#:
Work Performed: Worked with Comcast tech support over the phone and then with tech on-site to troubleshoot gateway. Gateway settings changed. Steve modified the gateway settings back to what they were originally. Once corrected, both BAS and camera system came back online. Placed all pumps and boilers back in AUTO mode. Verified operation.	

Recommendations

Summary						
Materials						
N/A						
Labor						
Technician	Hours					
David Dougherty	Reg Labor	4.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48750
Work Order #	48750
Service Date	01/17/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2003
Caller	Sani Umar

Location	Customer
BLACKWOOD Blackwood Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
investigate no heat in Boiler I section of building

Unit #:	Description:
Make:	Serial#:
Work Performed: boiler operating. circulation pumps were switched off overnight. pumps on and system heating. monitored system and notified facilities.	

Recommendations

Summary						
Materials						
00						
Labor						
Technician	Hours					
David Birkey	Reg Labor	2.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48736	
Work Order #	48736
Service Date	01/17/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2004
Caller	Sani Umar

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
investigate teachers lounge unit operation

Unit #:	Description:
Make:	Serial#:
Work Performed: found tstat batteries loose. fixed battery position. unit air leak keeps fan running constant. fixed air leak. unit operation shuts down on a rise in temperature. separate tstat does cooling in room.	

Recommendations

Summary						
Materials						
00						
Labor						
Technician	Hours					
David Birkey	Reg Labor	3.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48735	
Work Order #	48735
Service Date	01/16/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	1177
Caller	Sani Umar

Location	Customer
ERIAL EL Erial Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
classroom B8 unit making noise

Unit #:	Description:
Make:	Serial#:
Work Performed: facilities requested to investigate noise emitting from unit. found shaft connector to motor is weak and shaft is slipping. facilities notified.	

Recommendations

Summary						
Materials						
00						
Labor						
Technician	Hours					
David Birkey	Reg Labor	2.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48667
Work Order #	48518
Service Date	01/17/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2004
Caller	Sani Umar

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Follow up on Ticket #48518 Investigate room 103 unit operation

Unit #:	Description:
Unit #:	Serial#:
Work Performed: Completed service call. Left system in service.	

Recommendations

Summary						
Materials						
Labor						
Technician	Hours					
David Birkey	Reg Labor	8.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:
Master HVAC/R Contractor: Penna Electric



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48665
Work Order #	48516
Service Date	02/18/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2394
Caller	Sani Umar

Location	Customer
CHEWS EL Chews Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Follow up on Ticket #48516
investigate room 302 heat issues
zone valve in unit heater is seized and non functioning. ordering replacement from Broudy Precision. will install when parts are

Init #:	Description:
Make:	Serial#:
Work Performed: Drained piping and removed old valve. retrieved new 3/4 fittings to install valve. soldered in fittings and tightened unions. leak check revealed numerous leaks from existing piping. repairs not sufficient to contain leaks. will need to return with new fittings: 3/4 unions, 1/2 boiler drain, 3/4 male adapter and 3/4 coupling.	

Recommendations

Summary					
Materials					
D 11238, valve and actuator.					
Labor					
Technician	Hours				
David Birkey	Reg Labor	8.00	O/T Labor	0.00	Prem 0.00

Customer Signature

Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48626	
Work Order #	48626
Service Date	01/14/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	821
Caller	Sani Umar

Location	Customer
ANN MULL2 Ann A.Mullen Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Boilers are down.

Unit #:	Description:
Make:	Serial#:
Work Performed: No heat in building. N30's are offline. Found comcast modem is down and is not providing internet connection. Security company is working with Comcast to rectify connection issues. To get heat into building, put boiler pumps in hand and jumped out Boiler RIB relays to get boilers running. Once running, boilers were running at low temp due to operating limit being set to 160. Raised operating limit as well as manual reset high limit. Verified operation of Boiler. Picked up and installed new RIB relays with HOA override switch that way boilers can be easily enabled manually if the comcast modem goes down again. Set up credentials with JCI and verified access to server. Must return once comcast modem is fixed to put system back in auto	

Recommendations

Summary						
Materials						
PO 11251						
Labor						
Technician	Hours					
David Dougherty	Reg Labor	8.00	O/T Labor	0.00	Prem	0.00
Customer Signature						
Printed Name:						



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48618

Work Order #: 48618

Service Date: 01/14/2020

Ticket Type: Serv T&M

Category: HVAC T&M Service

Job#: 2394

Caller: Sani Umar

Location	Customer
CHEWS EL Chews Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

RTU in OT/PT rm not heating

Unit #:	Description:
Make:	Serial#:
Work Performed: checked room thermostat settings. set to heat and occupied mode. blower is circulating air in space. obtained access to rooftop and checked voltages from tstat to terminal connector. found R to G good, but R to W1 without a potential difference. removed W1 and placed jumper wire from R to W1 terminal. fan runs and electric heat engages. checked voltages, satisfactory. determination is that thermostat is malfunctioning and needs to be replaced. Johnson Controls has completed a building wide retrofit of thermostats and this control replacement should be handled by their personnel. facilities notified.	

Recommendations

Summary

Materials

00

Labor

Technician

Hours

David Birkey

Reg Labor

4.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48602
Work Order #	48602
Service Date	01/16/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	1141
Caller	Sani Umar

Location	Customer
CHARLES Charles W. Lewis Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
FLAME FAILURE BOILER #2

Unit #:	Description:
Make:	Serial#:
Work Performed: BOILER #2 Upon arrival, the custodian told me her boss fixed the problem. The intellacom was turned off. The intellacom is hooked to to limit circuit and wouldn't cause a pilot failure. The pilot failure comes directly from the flame safeguard control..	

Recommendations

Summary						
Materials						
Labor						
Technician	Hours					
Robert Reillo	Reg Labor	4.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48569
Work Order #	48389
Service Date	01/14/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2315
Caller	BIRKEY

Location	Customer
GLENDORA Glendora Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Follow up on Ticket #48392
Follow up on Ticket #48389 ADJUST THERMOSTATS IN CLASSROOMS.
verified classroom temps are satisfactory.

Unit #:	Description:
Make:	Serial#:
Work Performed: Discontinued troubleshooting of newly installed thermostats. facilities identified that Johnson Controls personnel are responsible to set up correct operation settings.	

Recommendations

Summary

Materials

00

Labor

Technician	Hours				
	Reg Labor	O/T Labor	Prem		
David Birkey	1.00	0.00	0.00		

Customer Signature

NO R E P

Printed Name:



Peterson Service Company

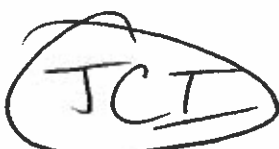
234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48567
Work Order #	47538
Service Date	01/16/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2004
Caller	Sani Umar

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Follow up on Ticket #48331
Follow up on Ticket #48222
Follow up on Ticket #47538

Unit #:	Description:
Make:	Serial#:
Work Performed: troubleshooting revealed; the heat control relay in the space is not eliminating a heat call due to the nature of making and breaking the ohms signal which controls burner operation in unit. ran new wire from unit to space in order to properly control burner and fan operation. system operation satisfactory at this time.	
	

Recommendations

Summary

Materials

00

Labor

Technician

David Birkey

Hours

Reg Labor

6.00

O/T Labor

0.00

Prem

0.00

Customer Signature



Printed Name:

Master HVAC/R Contractor: Renee Fiorelli

Page 1 of 1

Master HVAC/R Contractor Lic#: 19HC00380500



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48558	
Work Order #	48558
Service Date	01/10/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	682
Caller	Contract

Location	Customer
CHEWS EL Chews Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Classrooms 209 and 302 are down

Unit #:	Description:
Make:	Serial#:
Work Performed: -Classroom 209 has no heat. Found HW actuator is driving in reverse. JCI must come out and reverse valve action. Until they come out, disconnected HW actuator to get heat into space. -Classroom 302 has no heat. Found HW actuator is bad and must be replaced. Valve packing is leaking so entire valve must be replaced. Valved off valve/coil until it can be replaced	

Recommendations

Summary					
Materials					
N/A					
Labor					
Technician	Hours				
David Dougherty	Reg Labor	3.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70

Medford, NJ 08055

Tel: (609) 714-3699 Fax: (609) 714-3698

Email: service@petersonservice.com

Service Ticket #: 48539

Work Order #: 48469

Service Date: 01/10/2020

Ticket Type: Ctls T&M

Category: ATC T&M Service

Job#: 750

Caller: Sani Umar

Location

GLENLAND
Glen Landing Middle School

Customer

Gloucester Twp. Public Schools
17 Erial Rd.
Blackwood, NJ 08012

Work Requested

Cafeteria overheating.

Unit #:

Make:

Description:

Serial#:

Work Performed:

Added economizer programming in server to cafeteria units and monitored.

Recommendations

Summary

Materials

Labor

Technician

Stephen Suboleski

Hours

Reg Labor

1.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name:

Master HVAC/R Contractor: Renee Fiorelli



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 47538

Work Order #	47538
Service Date	12/20/2019
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2004
Caller	Sani Umar

Location

JAMES W.
James W Lilley, Jr Elementary School

Customer

Gloucester Twp. Public Schools
17 Erial Rd.
Blackwood, NJ 08012

Work Requested

investigate no heat in gym

11090 po for brody

Unit #:

Make:

Description:

Serial#:

Work Performed:

rooftop reznor unit not functioning. found 2nd stage valved off and disconnected. stage 1 off due to bad limit control. changed belts adjusted settings. outside damper open with no return. corrected damper position. stage 1 function good. will return at later date to investigate stage 2 operation and clean blower wheel.

Recommendations

Summary

Materials

limit control, belts

Labor

Technician

David Birkey

Hours

Reg Labor	6.00	O/T Labor	0.00	Prem	0.00
-----------	------	-----------	------	------	------

Customer Signature

Printed Name:

Master HVAC/R Contractor: Renee Fiorelli



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48518	
Work Order #	48518
Service Date	01/13/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2004
Caller	Sani Umar

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
investigate room 103 unit operation

Unit #:	Description:
Make:	Serial#:
Work Performed: unit fan motor does not run when selector is in low or high. traced back electric. power is available but not continuing through to motor. transformer is not functioning. will order new transformer and return to install.	

Recommendations

Summary					
Materials					
00					
Labor					
Technician	Hours				
David Birkey	Reg Labor	4.00	O/T Labor	0.00	Prem 0.00

Customer Signature
<i>NORTH</i>
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48516	
Work Order #	48516
Service Date	01/13/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2394
Caller	Sani Umar

Location	Customer
CHEWS EL Chews Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
investigate room 302 heat issues

Unit #:	Description:
Make:	Serial#:
Work Performed: zone valve in unit heater is seized and non functioning. ordering replacement from Broudy Precision. will install when parts are available.	

Recommendations

Summary					
Materials					
00					
Labor					
Technician	Hours				
David Birkey	Reg Labor	4.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48495	
Work Order #	48495
Service Date	01/09/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	793
Caller	Contract

Location	Customer
LORING-F Loring-Flemming School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Troubleshoot Old Boiler's flow issues

Unit #:	Description:
Make:	Serial#:
Work Performed: Old Boiler is Valved off and can not run. Found when Boiler isolation valves are open, water takes the path of least resistance and flows through the old boiler that is not running and cold water enters into the E wing. Isolation control valve must be installed to make changeover automatic when the backup boiler is enabled. Until an automatic isolation valve is installed, the boiler must be isolated. When boiler fires up, there is a substantial vibration in the boiler. Suspect there is a combustion issue which is causing the burner to vibrate. Will have our boiler guy connect to boiler with a combustion analyzer to evaluate boiler.	

Recommendations

Summary					
Materials					
N/A					
Labor					
Technician	Hours				
David Dougherty	Reg Labor	2.00	O/T Labor	0.00	Prem 0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48494	
Work Order #	48494
Service Date	01/09/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	750
Caller	Contract

Location	Customer
GLENLAND Glen Landing Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Rm 106 is overheating

Unit #:	Description:
Make:	Serial#:
Work Performed: -Room 106 is overheating. Upon troubleshooting, found the OA damper signal and the HW valve signal were switched so when the hot water valve was being commanded to open or close the OA damper was actually opening and closing. Switch signal wires on the controller and verified operation. -Classroom 305 fan is not running each morning. Verified motor and capacitor is good. Once motor is manually spun, motor starts up and runs as it should. Can try installing a larger microfarad capacitor to see if that helps jump start the motor. -Both cafeteria units are overheating. Found 1B HW valve actuator is not driving and is stuck in its position. Verified signal voltage. Actuator is bad and must be replaced. Must return when kids are not present to get actuator information for replacement. 1A HW valve actuator is driving as it should but appears to be passing. Must return when kids are not present.	

Recommendations

Summary						
Materials						
N/A						
Labor						
Technician	Hours					
David Dougherty	Reg Labor	6.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48469
Work Order #	48469
Service Date	01/10/2020
Ticket Type	Ctls T&M
Category	ATC T&M Service
Job#	750
Caller	Sani Umar

Location	Customer
GLENLAND Glen Landing Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Cafeteria overheating.

Unit #:	Description:
Make:	Serial#:
Work Performed: -Continued troubleshooting both HW control valves in Cafeteria. 1A control valve actuator is unable to keep valve stem 100% closed and continues to lift stem as actuator motor has become weak. Ordered and picked up 2 new replacement actuators. Disconnected and removed actuators on both Cafe units. Installed new actuators and verified operation. Steve added logic in the head end to open OA dampers to economize as the dampers weren't being commanded open from the UNT controller. This will help cool the space in the winter time. -Installed higher microfarad capacitor for blower motor. Motor started up and ran as it should.	

Recommendations

Summary

Materials

N/A

Labor

Technician	Hours				
	Reg Labor	O/T Labor	Prem		
David Dougherty	5.00	0.00	0.00		

Customer Signature

Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48455
Work Order #	48350
Service Date	01/15/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	1840
Caller	Sani Umar

Location	Customer
LORING-F Loring-Flemming School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Follow up on Ticket #48350 repairs to classroom units

Unit #:	Description:
Make:	Serial#:
Work Performed: Classroom E9 thermostat is malfunctioning. replaced with new stat. and return air sensor. wired controls and operated unit. system operation satisfactory at this time. C7, fixed numerous air leaks, lubricated damper. no zone valve for heating. A12, air pressure not present to unit. will continue investigation of cause .	

Recommendations

Summary						
Materials						
11206 PO for sensor						
Labor						
Technician	Hours					
David Birkey	Reg Labor	8.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48442
Work Order #	48422
Service Date	01/10/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	1141
Caller	Sani Umar

Location	Customer
CHARLES Charles W. Lewis Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
BOILER IS TRIPPING. PETERSON TECHNICIAN DAVE DOUGHERTY CALLED IN. 856-381-9249

Unit #: BLR2	Description: Boiler 2
Make:	Serial#:
Work Performed: BOILER #2 RHF, Replaced igniter with a new one that was in the burner cabinet. Checked all pilot wiring. Checked pilot valve by jumping it many times while using a manometer. Set pilot gas pressure to 2.3"wc..	

Recommendations

Summary					
Materials					
Labor					
Technician	Hours				
Robert Reillo	Reg Labor	4.00	O/T Labor	0.00	Prem
					0.00

Customer Signature
Printed Name:
Master HVAC/R Contractor: Renee Fiorelli



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48422
Work Order #	48422
Service Date	01/09/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	1141
Caller	Sani Umar

Location	Customer
CHARLES Charles W. Lewis Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
BOILER IS TRIPPING. PETERSON TECHNICIAN DAVE DOUGHERTY CALLED IN. 856-381-9249

Unit #: BLR2	Description: Boiler 2
Make:	Serial#:
Work Performed: BOILER #2 RHF Powerflame Model #WCR4-G-25 Serial #060308986... Cycled boiler several time and there was no ignition. Pulled pilot assembly and found a carbon buildup. Cleaned and readjusted the electrode. Cycled burner many time and had ignition each time. BOILER is operating at this time. See Recommendations	

Recommendations
Need to return tomorrow (1/10) to put analyzer on the boiler and to check the gas valves. Saw they were leaking fluid and they need to be checked.

Summary					
Materials					
Labor					
Technician	Hours				
Robert Reillo	Reg Labor	2.00	O/T Labor	0.00	Prem
					0.00

Customer Signature
Printed Name:
Master HVAC/R Contractor: Renee Fiorelli



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48427	
Work Order #	48325
Service Date	01/14/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2315
Caller	Sani Umar

Location	Customer
GLENDORA Glendora Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Follow up on Ticket #48325
repair valve actuator

Unit #:	Description:
Make:	Serial#:
Work Performed: replaced actuator diaphragm and verified operation.	

Recommendations

Summary

Materials

00 customer supplied all parts necessary

Labor

Technician	Hours			
	Reg Labor	O/T Labor	Prem	
David Birkey	3.00	0.00	0.00	

Customer Signature

[Handwritten Signature]

Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48422

Work Order #: 48422

Service Date: 01/09/2020

Ticket Type: Serv T&M

Category: HVAC T&M Service

Job#: 1141

Caller: Sani Umar

Location

CHARLES
Charles W. Lewis Middle School

Customer

Gloucester Twp. Public Schools
17 Erial Rd.
Blackwood, NJ 08012

Work Requested

BOILER IS TRIPPING. PETERSON TECHNICIAN DAVE DOUGHERTY CALLED IN. 856-381-9249

Unit #: BLR2

Make:

Description: Boiler 2

Serial#:

Work Performed:

BOILER #2 RHF Powerflame Model #WCR4-G-25 Serial #060308986... Cycled boiler several time and there was no ignition. Pulled pilot assembly and found a carbon buildup. Cleaned and readjusted the electrode. Cycled burner many time and had ignition each time. BOILER is operating at this time.
See Recommendations

Recommendations

Need to return tomorrow (1/10) to put analyzer on the boiler and to check the gas valves. Saw they were leaking fluid and they need to be checked.

Summary

Materials

Labor

Technician

Robert Reillo

Hours

Reg Labor

2.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name:

Master HVAC/R Contractor: Renee Fiorelli



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48392	
Work Order #	48389
Service Date	01/09/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2315
Caller	BIRKEY

Location	Customer
GLENDORA Glendora Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Follow up on Ticket #48389 ADJUST THERMOSTATS IN CLASSROOMS.

Unit #:	Description:
Make:	Serial#:
Work Performed: verified classroom temps are satisfactory. main office air handler not functioning. traced unit electric as power is not present. found control box with switch in off position. restored power and verified operation. room sensors are not controlling heating valve. will return to investigate control issues.	

Recommendations

Summary						
Materials						
00						
Labor						
Technician	Hours					
David Birkey	Reg Labor	5.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48389	
Work Order #	48389
Service Date	01/08/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2315
Caller	BIRKEY

Location	Customer
GLENDORA Glendora Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

ADJUST THERMOSTATS IN CLASSROOMS.

Unit #:	Description:
Make:	Serial#:
Work Performed: Rooms with new tstats are not responding well with setpoints. Air pressure supplied to units makes even temperature control in attainable. Factory setting of 16psi shuts down heating at set point and opens outside air full. Lowering psi supply to units gives a better temp range without drastic fluctuations. More calibration is needed to ensure unit discharge air sensors are corresponding with room thermostat operation.	

Recommendations

Summary

Materials

00

Labor

Technician	Hours			
	Reg Labor	O/T Labor	Prem	
David Birkey	8.00	0.00		0.00

Customer Signature

[Handwritten Signature]

Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48384	
Work Order #	48384
Service Date	01/07/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	804
Caller	Contract

Location	Customer
GLENDORA Glendora Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Work with Johnson Controls to get NAE's online

Unit #:	Description:
Make:	Serial#:
Work Performed: Worked with Johnson Controls to get NAE's online for Glendora, Chews, and Loring Fleming	

Recommendations

Summary

Materials

N/A

Labor

Technician	Hours			
	Reg Labor	O/T Labor	Prem	
David Dougherty	8.00	0.00	0.00	

Customer Signature

Printed Name:



Peterson
Service Company

234 Route 70

Medford, NJ 08055

Tel: (609) 714-3699 Fax: (609) 714-3698

Email: service@petersonservice.com

Service Ticket #: 48350

Work Order # 48350

Service Date 01/09/2020

Ticket Type Serv T&M

Category HVAC T&M Service

Job# 1840

Caller Sani Umar

Location	Customer
LORING-F Loring-Flemming School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

repairs to classroom units

Unit #:	Description:
Make:	Serial#:
Work Performed: room E9 has a thermostat that is not functioning. will replace stat and return air sensor. ordered sensor from Broudy Precision.	

Recommendations

Summary

Materials

00

Labor

Technician	Hours				
	Reg Labor	O/T Labor	Prem		
David Birkey	3.00	0.00	0.00		

Customer Signature

Printed Name:



Peterson Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48348

Work Order #: 48293

Service Date: 05/22/2020

Ticket Type: Serv T&M

Category: HVAC T&M Service

Job#: 1840

Caller: Sani Umar

Location

LORING-F
Loring-Flemming School

Customer

Gloucester Twp. Public Schools
17 Erial Rd.
Blackwood, NJ 08012

Work Requested

Follow up on Ticket #48293
repairs to classroom units

Unit #:

Description:

Make:

Serial#:

Work Performed:

replace control valve in room C4. dismantled unit and removed valve, drained water. Will return with fittings to install new valve, old steel fittings vastly corroded.

Recommendations

Summary

Materials

00

Labor

Technician

Hours

David Birkey

Reg Labor

5.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48331	
Work Order #	47538
Service Date	01/10/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2004
Caller	Sani Umar

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Follow up on Ticket #48222
Follow up on Ticket #47538
investigate no heat in gym

Unit #:	Description:
Make:	Serial#:
Work Performed: installed 2 new heat control modules and pilot burner assemblies. initiated heat cycle. both stages of heat are functioning correctly. Unit controller is intermittent and do not shut down operation after a call for heat has been satisfied. further troubleshooting is necessary to find cause of malfunction.	

Recommendations

Summary

Materials

11090

Labor

Technician	Hours			
	Reg Labor	O/T Labor	Prem	
David Birkey	8.00	0.00	0.00	0.00

Customer Signature

[Handwritten Signature]

Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48325

Work Order #: 48325

Service Date: 01/07/2020

Ticket Type: Serv T&M

Category: HVAC T&M Service

Job#: 2315

Caller: Sani Umar

Location	Customer
GLENDORA Glendora Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

repair valve actuator

Unit #:	Description:
Make:	Serial#:
Work Performed: found valve actuator with tear in diaphragm. will return to replace.	

Recommendations

Summary

Materials

00

Labor

Technician

Hours

David Birkey

Reg Labor

2.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48293
Work Order #	48293
Service Date	01/07/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	1840
Caller	Sani Umar

Location	Customer
LORING-F Loring-Flemming School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

repairs to classroom units

Unit #:	Description:
Make:	Serial#:
Work Performed: room C4, heating valve is leaking. isolated water and disassembled cabinet to retrieve valve info. ordered new valve from Broudy PO 11187. E wing has no heat. circulation pumps are running and boiler is firing. switched pumps. circulation of hot water improved.	

Recommendations

Summary

Materials

11187

Labor

Technician	Hours			
	Reg Labor	O/T Labor	Prem	
David Birkey	6.00	0.00		0.00

Customer Signature

[Handwritten Signature]

Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48222	
Work Order #	47538
Service Date	01/06/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	2004
Caller	Sani Umar

Location	Customer
JAMES W. James W Lilley, Jr Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Follow up on Ticket #47538
investigate no heat in gym

Unit #:	Description:
Make:	Serial#:
Work Performed: installed filters and burner assembly. unit is operational by 1 stage of heat only. stage 2 control module will need further diagnostic.	

Recommendations

Summary

Materials

PO 11170, burner pilot.

Labor

Technician	Hours				
	Reg Labor	O/T Labor	Prem		
David Birkey	4.00	0.00	0.00		

Customer Signature

Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48212	
Work Order #	48212
Service Date	01/03/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	804
Caller	Contract

Location	Customer
GLENDORA Glendora Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Work with JCI to configure Comcast Modem/NAE

Unit #:	Description:
Make:	Serial#:
Work Performed: Work with JCI to configure Comcast Modem/NAE	

Recommendations

Summary						
Materials						
N/A						
Labor						
Technician	Hours					
David Dougherty	Reg Labor	8.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48161	
Work Order #	48161
Service Date	01/02/2020
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	804
Caller	Contract

Location	Customer
GLENDORA Glendora Elementary School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
Configure Comcast Router for Johnson Controls

Unit #:	Description:
Make:	Serial#:
Work Performed: -Worked on Configuring Comcast Router for Johnson controls. -Met with Johnson Controls to go over current project and deficiencies	

Recommendations

Summary						
Materials						
N/A						
Labor						
Technician	Hours					
David Dougherty	Reg Labor	6.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 48133	
Work Order #	48129
Service Date	01/03/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	1840
Caller	Sani Umar

Location	Customer
LORING-F Loring-Flemming School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested
REPAIR CLASSROOM UNITS

Unit #:	Description:
Make:	Serial#:
Work Performed: room C2, fixed pneumatic leaks in unit. verified response from tstat to control outside air damper and heating valve. Room C3, repaired damper actuator and freed up linkage.	

Recommendations

Summary						
Materials						
00						
Labor						
Technician	Hours					
David Birkey	Reg Labor	4.00	O/T Labor	0.00	Prem	0.00

Customer Signature
Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #:	48129
Work Order #	48129
Service Date	01/02/2020
Ticket Type	Serv T&M
Category	HVAC T&M Service
Job#	1840
Caller	Sani Umar

Location	Customer
LORING-F Loring-Flemming School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

REPAIR CLASSROOM UNITS

Unit #:	Description:
Make:	Serial#:
Work Performed: Room C1. found unit blower not functioning and blower wheel with severe dirt build up on blades. changed bearing. cleaned blower wheel blades. fan is now operational.	

Recommendations

Summary

Materials

00 customer supplied all parts necessary

Labor

Technician	Hours				
	Reg Labor	O/T Labor	Prem		
David Birkey	8.00	0.00	0.00		

Customer Signature

Printed Name:



Peterson
Service Company

234 Route 70
Medford, NJ 08055
Tel: (609) 714-3699 Fax: (609) 714-3698
Email: service@petersonservice.com

Service Ticket #: 47984	
Work Order #	47984
Service Date	12/27/2019
Ticket Type	Ctl's T&M
Category	ATC T&M Service
Job#	750
Caller	Contract

Location	Customer
GLENLAND Glen Landing Middle School	Gloucester Twp. Public Schools 17 Erial Rd. Blackwood, NJ 08012

Work Requested

Rm 106 controller is offline

Unit #:	Description:
Make:	Serial#:
Work Performed: Controller is offline. Controller is powered up but not communicating. Controller got wet during the coil burst. Controller is bad and must be replaced. Controller is not made anymore and must be upgraded to PCG controller. Installed new controller. Steve created a new program and downloaded. Upon commissioning, found HW valve actuator is bad, DA temp sensor is bad, and wall sensor warm/cool adjust is bad. Replaced all 3 components and verified operation.	

Recommendations

Summary

Materials

Customer stock

Labor

Technician

Hours

David Dougherty

Reg Labor

4.00

O/T Labor

0.00

Prem

0.00

Customer Signature

Printed Name: