

WTI DAILY FIELD REPORT

50

WORK ORDER #: 9487844
 PROJECT INFORMATION:
 Date: 9-25-17 # of Days Worked 1 of
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Pine Lands
 Location: Little Egg Harbour N.J.
 Roof Designation: 1-6-4
 Weather: Hot Humid 90°
 Owner Rep: New Rd.
 Telephone: 856 424 8888
 Present at Site: Robert Mauro Tremco
 Start Time: 6:30 Stop Time:

ROOFING SYSTEM INFORMATION: Spec
 Preparation: Removal ☐
 Deck Type: Metal ☐
 Priming: W.B. ☐
 Wood Blocking: P.T. ☐
 Cant: Vapor Retarder: ☐
 Insulation Type: E.S.O. Thickness: 5 " ☐
 Attachment: Mechanical ☐
 Second Layer Type: Fiber Thickness: 1/2 " ☐
 Attachment: Hot ☐
 Daily Waterstop: Asphalt ☐
 Roof System: Power Ply ☐

CONTRACTOR INFORMATION:
 Name: Mike Kobithen Roofing
 Contact: Bob Law
 Foreman: Frank Brannigan
 Crew Size: 24
 Office Telephone: 215.533.3118
 Other:
 Rep: Rob Hamersky, Ed Broderick

Flashings: M.B. ☐
 Perimeter: 1" ☐
 Walls: 1" ☐
 Curbs: 1" ☐
 Pitch Pans: ☐
 Tie-ins: ☐
 Interply Matl. Rate: 2 gals/sq Flood Coat: gals/sq
 Kettle Temp.: at a.m. / at p.m.

Daily Activity and General Notes:

1st Day on Job. Meet with New Road
Const. Mang. Rob Sannino. An Bob Law Roofing Super.
Rob Sannino concerned about chicken Pox leak and
strooth mark's on Finished Cap Sheet Power Ply F.R.
Rob Mauro from Cleveland called out to Site to Examine,
he see's no Ingression Problems, took a sample with him, we
will Await the results. Although he see's no sign of future
Roof or sheet's Failure. I saw this primary on Roofs 1
And 6

Contractor: [Signature]

Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative
 Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9487844

PROJECT INFORMATION:

Date: 9-26-17 # of Days Worked 2 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: PINELANDS H. SCHOOLLocation: LITTLE CAG HARBOR, N.J.Roof Designation: 4.6.1Weather: Breezy 76°Owner Rep: Bob SamanoTelephone: 856-424-8888

Present at Site: _____

Start Time: 6:30 Stop Time: _____

CONTRACTOR INFORMATION:

Name: Mike KobithenContact: Bob LawForeman: Frank BruningaCrew Size: 17Office Telephone: 856-424-8888

Other: _____

Rep: Rob Hamerski

ROOFING SYSTEM INFORMATION: Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: W.B ☐Wood Blocking: P.T. ☐Cant: Fiber Vapor Retarder: ☐Insulation Type: I.S.O Thickness: 5" ☐Attachment: Mech. ☐Second Layer Type: Fiber Thickness: 1/2" ☐Attachment: Hot ☐Daily Waterstop: Hot ☐Roof System: Power ply ☐Flashings: M.B ☐Perimeter: " ☐Walls: " ☐Curbs: " ☐Pitch Pans: Lead ☐Tie-ins: ☐Interply Matl. Rate: 2 gals/sq Flood Coat: _____ gals/sq

Kettle Temp.: _____ at _____ a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

2 Roofers continue to flash curbs on perimeter with
 on Roof 1. On Roof 6 5 roofers remove curb and replace
 decking. Install insulation and a ply base. Move dog to
 that roof and weld end laps on Giant Fico Seams. Recommend
 to roofers anywhere they see a low spot to add some base
 sheet. On Roof 4 Roofers continue to install power ply F.R.
 Add base sheet around 1 low spot near curb. Heavy mist
 and fog this morning Roofers were preped during this time,
 until the dry. Any where base sheet is stained by other
 trades, these areas will be Asphalt primed.

Contractor: JimmyInspector: Jim Ham

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9487844

PROJECT INFORMATION:

Date: 9.27.17 # of Days Worked 3 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pinebluffs High SchoolLocation: Little Egg HarborRoof Designation: 4.6.9.1Weather: Wet Fog MistOwner Rep: Bob SpanningTelephone: 886 424 8888

Present at Site: _____

Start Time: 6:30 Stop Time: _____

CONTRACTOR INFORMATION:

Name: Mike Kobithen RoofingContact: Bob LawForeman: Frank BranniganCrew Size: 17Office Telephone: 856 424 215-533-3118

Other: _____

Rep: Rob Hamerski, Ed Broderick

ROOFING SYSTEM INFORMATION: Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: W.B ☐Wood Blocking: P.T ☐Cant: Fiber Vapor Retarder: n/a ☐Insulation Type: I.S.O Thickness: 5" ☐Attachment: Mech. ☐Second Layer Type: Fiber Thickness: 1/2" ☐Attachment: Hot ☐Daily Waterstop: Hot ☐Roof System: Power Ply ☐Flashings: M.B ☐Perimeter: " ☐Walls: " ☐Curbs: LEAD ☐Pitch Pans: Lead ☐Tie-ins: Asphalt ☐Interply Matl. Rate: 2 gals/sq Flood Coat: _____ gals/sq

Kettle Temp.: _____ at _____ a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

Roof 4: Roof was completed today Power Ply has been laid. All seams to be heat welded at a later date. Again Had to dry off All Roofs, due to Fog + Mist. 2 men Heat welding End Laps on Field Seams. Roof area 1, 4 Roofs Continue to work on Perimeter sheets and curbs

Roof 9: End Laps and field Seams Heat welded. I tell each gang to call me a day ahead of when they plan to finish, so I can start a Punch list and complete the list all at 1 time

Contractor: [Signature]Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9487844

PROJECT INFORMATION:

Date: 9.28.17 # of Days Worked 4 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pine Lands High SchoolLocation: Little Egg HarborRoof Designation: 5.6.1Weather: Windy 80°Owner Rep: Bob Simon & Bob SanandoTelephone: 886.425.8888Present at Site: Rob HameskiStart Time: 6:30 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobrthen RoofingContact: Bob LawForeman: Frank BrennanCrew Size: 20Office Telephone: 215.533.3118

Other:

Rep: Rob Hameski

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: W/B ☐Wood Blocking: P.T ☐Cant: ☒ Vapor Retarder: ☒Insulation Type: I.S.O Thickness: 5 " ☐Attachment: Mech. ☐Second Layer Type: Brown Thickness: 1/2 " ☐Attachment: Hot ☐Daily Waterstop: Hot ☐Roof System: Power Ply ☐Flashings: FL ☐Perimeter: FL ☐Walls: FL ☐Curbs: FL ☐Pitch Pans: LEAD ☐Tie-ins: ELLS ☐Interply Matl. Rate: 2.5 gals/sq Flood Coat: 2.5 gals/sqKettle Temp.: at a.m. / at p.m.

Daily Activity and General Notes:

Because of Dust in Flutes, on Roof 8 and 10. New Roof has got to be removed, Flutes VACUUMED. We will go back with 5" of I.S.O, And Brown Board. A change order has been submitted For these AREAS, the brown board will not be going down in hot. We will be using old Board slow rise Foam Met with Rob Hameski, Mike Kobrthen, BOB LAW and Const. Managment, New Road Const. End Result is ALL discrepancies on Power Ply Granulated Cap Sheet, will not impede on roof as sheets per formance

Contractor: JulyInspector: Jim

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9487844
 PROJECT INFORMATION:
 Date: 9.29.17 # of Days Worked 5 of
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Pinelands High School
 Location: Little Egg Harbor N.J.
 Roof Designation: 1-3-5-4
 Weather: 70°
 Owner Rep: Bob Simmons
 Telephone: 886-425-8888
 Present at Site: Bob Law
 Start Time: 6:30 Stop Time:

ROOFING SYSTEM INFORMATION: Spec
 Preparation: Remedy ☐
 Deck Type: Metal ☐
 Priming: W.B. ☐
 Wood Blocking: PT ☐
 Cant: NA Vapor Retarder: NA ☐
 Insulation Type: I-50 Thickness: 5" ☐
 Attachment: Mech. Fastened ☐
 Second Layer Type: Drum Thickness: 1/2" ☐
 Attachment: Hot ☐
 Daily Waterstop: Hot ☐
 Roof System: Power ply ☐

CONTRACTOR INFORMATION:
 Name: Mike Kobithen Roofing
 Contact: Bob Law
 Foreman: Frank Brannigan
 Crew Size: 24
 Office Telephone: 215-533-3118
 Other:
 Rep: Rob Hamerski

Flashings: MB ☐
 Perimeter: LI ☐
 Walls: LI ☐
 Curbs: LI ☐
 Pitch Pans: Lead ☐
 Tie-ins: Cement ☐
 Interply Matl. Rate: 25 gals/sq Flood Coat: gals/sq
 Kettle Temp.: at a.m. / at p.m.

Daily Activity and General Notes:

Roof ① I go over entire Roof and mark several Areas for Repair. Check Seams with Probe.
 Roof 3: Scraped off all debris and dried. Grass off center while to figure out how to start and keep straight.
 Bob Simmons points out some curbs were not fitted with Crickets, we will add crickets before white Cap.
 Roof 4 and 5 Flash Layed, crew drops back and Insures walls and Flash Curbs.

Contractor: JBInspector: Jim J...

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative
 Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9487844

PROJECT INFORMATION:

Date: 9.30.17 # of Days Worked 6 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pine Lands School DistrictLocation: Little Egg HarbourRoof Designation: 8.10Weather: Cool WindyOwner Rep: Bob SimminoTelephone: 886 425 8888Present at Site: Mike Kobithen, Curt SimsStart Time: 6:30 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobithen RoofingContact: Bob LawForeman: Frank BranniganCrew Size: 25Office Telephone: 215.533.3118

Other:

Rep: Rob Homerski

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: W.B ☐Wood Blocking: BT ☐Cant: Fiber Vapor Retarder: N/A ☐Insulation Type: ISO Thickness: 5 " ☐Attachment: mech ☐Second Layer Type: Brown Thickness: 1/2 ☐Attachment: old Bond ☐Daily Waterstop: Camon 7 ☐Roof System: Power Ply ☐Flashings: M.B ☐Perimeter: 1 ☐Walls: 11 ☐Curbs: 11 ☐Pitch Pans: Lead ☐Tie-ins: Cement ☐Interply Matl. Rate: 25 gals/sq Flood Coat: 25 gals/sqKettle Temp.: N/A a.m. / 1 at 1 p.m.

Daily Activity and General Notes:

30 was removed from roof, this section was done but dust was found to be coming thru Acoustical Ceilings. James Orgera and Curt Sims on site for Asbestos James Orgera was inside with Asbestos Monitors which showed no Asbestos. Curt Sims on roof to inspect deck. Industrial Vacuum was used to clean flutes. Brown Board was put down with Oh bond slow rise Foam Adhesive. Change order was issued for this spec. We will continue to remove these roofs. Dead line is Fri.

Contractor: [Signature]Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9487844

PROJECT INFORMATION:

Date: 10-1-17 # of Days Worked 7 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pine Lands School District

Location: Little Egg Harbour N.J.

Roof Designation: 10

Weather: Cool Breezy

Owner Rep: Bob Simm 100

Telephone: 886 425-8888

Present at Site:

Start Time: Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobithen Roofing

Contact: Bob Law

Foreman: Floyd

Crew Size: 27

Office Telephone: 215 533 3118

Other:

Rep: Rob Hamerski

ROOFING SYSTEM INFORMATION: Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: W.B. ☐Wood Blocking: P.T. ☐Cant: Fiber Vapor Retarder: NA ☐Insulation Type: ISO Thickness: 5" ☐Attachment: Mech. ☐Second Layer Type: Fiber Thickness: 1/2" ☐Attachment: Slow Rise Foam ☐Daily Waterstop: Cement ☐Roof System: Powerply ☐Flashings: M.B. ☐Perimeter: " ☐Walls: " ☐Curbs: " ☐Pitch Pans: LEAD ☐Tie-ins: Cement ☐

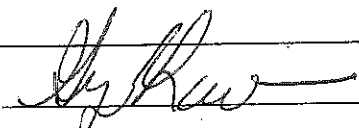
Interply Matl. Rate: 2.5 gals/sq Flood Coat: gals/sq

Kettle Temp.: at a.m. / at p.m.

Daily Activity and General Notes:

Roofers Continue to Remove New Roof on Area 10. Flutes were Vacuumed, Curbs were Lifted and Vacuumed underneath.

2 Layers of 2.5 ISO was mech. FASTENED 16 Plates and Screws per 4x8 sheet. Brown Boards were Adhered with Ori Bond and Rolled with heavy roller. Tie Ins cut back. 1 Ply of Comp. Ply was Adhered with Power Ply Cold Adhesive. Crickets Put in Place. Power Ply Broomed per spec.

Contractor: Inspector: 

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9482844

PROJECT INFORMATION:

Date: 10/2/17 # of Days Worked 8 of

Is This Full-time Inspection? ☒ Yes ☐ No

Are Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pineland School D

Location: Little Egg Harbor

Roof Designation: 10

Weather: 75°

Owner Rep: Bob Simmon

Telephone: 886 425 8888

Present at Site: Bob Simmon, Mike Kobithan

Start Time: 6:30 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobithan Roofing

Contact: Bob Law

Foreman:

Crew Size: 22

Office Telephone: 215 533 3118

Other:

Rep: Rob Hamerski

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Remove ☐

Deck Type: Metal ☐

Priming: AF W.B. ☐

Wood Blocking: RT ☐

Cant: Fiber Vapor Retarder: N/A ☐

Insulation Type: I.S.O Thickness: 5" ☐

Attachment: Mech ☐

Second Layer Type: Brown Thickness: 1/2" ☐

Attachment: OliBond ☐

Daily Waterstop: Cement ☐

Roof System: Power Ply ☐

Flashings: M/B ☐

Perimeter: L ☐

Walls: L ☐

Curbs: L ☐

Pitch Pans: Lead ☐

Tie-ins: Cement ☐

Interply Matl. Rate: 2.5 gals/sq Flood Coat: gals/sq

Kettle Temp.: 4/17 a.m. / at p.m.

Daily Activity and General Notes:

Roof 10: Roofers removed approx. 25'x of new roof. Acoustical Ceiling was cleaned with ~~Acoustic~~ Industrial VAC, Cut Sins from T.I.T. check deck for any Pitch or Asbestos there was none. 1. Ac unit was off loaded from Roof so Roof could be removed underneath.

New Iso. was installed in bottom flutes. 2 Layers of 2.5 Iso. was mech. Fastened to deck. Crickets Fabricated and Installed. Using Oli Bond slow rise Form. Brown Board also adhered this way. 1ply Comp-H.T. Adhered

Contractor:

Inspector:

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

I. power ply standard cold adhesive. tie ins mucked and FABRICATED

WTI DAILY FIELD REPORT

WORK ORDER #: 9487844
 PROJECT INFORMATION:
 Date: 10/3/17 # of Days Worked 9 of
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Dunelmans H. School
 Location: Little egg Harbour, N.J.
 Roof Designation: 18
 Weather: 47° - 67°
 Owner Rep: Bob Simmuno
 Telephone: 886-425-8888
 Present at Site: Rob Hamerski, Bob Simmuno
 Start Time: 7:00 Stop Time:

ROOFING SYSTEM INFORMATION: Spec
 Preparation: Remove ☐
 Deck Type: Metal ☐
 Priming: WB ☐
 Wood Blocking: PT ☐
 Cant: Fiber Vapor Retarder: n/a ☐
 Insulation Type: ISO Thickness: 5" ☐
 Attachment: MECH ☐
 Second Layer Type: BROWN Thickness: 1/2" ☐
 Attachment: GL Bond ☐
 Daily Waterstop: Cement ☐
 Roof System: Power Ply ☐

CONTRACTOR INFORMATION:

Name: Mike Kobithen Roofing
 Contact: Bob Law
 Foreman: Steve Brown
 Crew Size: 23
 Office Telephone: 215-533-3118
 Other:
 Rep: Rob Hamerski

Flashings: M.B ☐
 Perimeter: M.B ☐
 Walls: M.B ☐
 Curbs: M.B ☐
 Pitch Pans: LEAD ☐
 Tie-ins: Cement ☐
 Interply Matl. Rate: 2.5 gals/sq Flood Coat: gals/sq
 Kettle Temp.: M/Dat a.m. / at p.m.

Daily Activity and General Notes:

Yesterday, smell was reported in School after investigation
smell, smelled like Mineral spirits, We found no mineral spirits,
on Roof found 1 empty muck can NEAR Gravity Vent. Moved
No Smell this morning. All of this before we opened air 1st can.
Today they close School and school across the Street J.R. High.
Several meetings being held today, out come will be reported
Tanoraw. Tell carpenters to Lay ply wood in three work
Area to protect roof we put on, on Sun, Tell roofers to stack
wet inso aside an, not to use, INSTALLED 2 AREAS OF
metal Decking 2x2' and 1 6' Acoustical Decking

Contractor: [Signature]

Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9487844
 PROJECT INFORMATION:
 Date: 10/4/17 # of Days Worked 10 of _____
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Pinelands High School
 Location: Little Egg Harbour N.J.
 Roof Designation: 10
 Weather: 80°
 Owner Rep: Bob Simm, MD
 Telephone: 886-425-8888
 Present at Site: Mike Kobithan, Bob S.
 Start Time: 7:00 Stop Time: _____

CONTRACTOR INFORMATION:

Name: Mike Kobithan Roofing
 Contact: Bob Law
 Foreman: ~~Mike~~
 Crew Size: 20
 Office Telephone: 215-533-3118
 Other: _____
 Rep: Bob Hannericki

ROOFING SYSTEM INFORMATION: Spec

Preparation: Remove ☐
 Deck Type: Metal ☐
 Priming: N.S. ☐
 Wood Blocking: P.T. ☐
 Cant: Fiber Vapor Retarder: n/a ☐
 Insulation Type: I.S.O. Thickness: 5 " ☐
 Attachment: mech. ☐
 Second Layer Type: Brown Thickness: 1/2 " ☐
 Attachment: Oil bond ☐
 Daily Waterstop: Cement ☐
 Roof System: Power Ply ☐

Flashings: M.B. ☐
 Perimeter: " ☐
 Walls: " ☐
 Curbs: " ☐
 Pitch Pans: Lead ☐
 Tie-ins: Cement ☐
 Interply Matl. Rate: 25 gals/sq Flood Coat: _____ gals/sq
 Kettle Temp.: _____ at 4 p.m. / _____ at _____ p.m.

Daily Activity and General Notes:

School Closed for the 2nd day, while more Air Samples are taken. Corner over office removed today. Along with Roofing under unit left from over the weekend under unit roof removed 1 new curb installation, under P.T. Lumber was installed. Metal Deck cleaned and inspected by Cliff from environmental Company. Insulation was installed and all areas 1plied. tie ins completed for the note.

Contractor: _____

Inspector: _____

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9487844
 PROJECT INFORMATION:
 Date: 10.5.17 # of Days Worked 11 of
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name:
 Location: Pine Lands High School
 Roof Designation: 10
 Weather: 80°
 Owner Rep: Bob Simino
 Telephone: 886.425.8888
 Present at Site: Bob Simino
 Start Time: 7.00 Stop Time:

ROOFING SYSTEM INFORMATION: Spec
 Preparation: Remove ☐
 Deck Type: Metal ☐
 Priming: W.B. ☐
 Wood Blocking: P.T. ☐
 Cant: Fiber Vapor Retarder: N/A ☐
 Insulation Type: ISO Thickness: 5" ☐
 Attachment: Mech. ☐
 Second Layer Type: Brown Thickness: 1/2" ☐
 Attachment: Oli bond ☐
 Daily Waterstop: Cement ☐
 Roof System: Power Ply ☐

CONTRACTOR INFORMATION:
 Name: Mike Kobithen Roofing
 Contact: Bob Law
 Foreman: Steve Young, Floyd
 Crew Size: 20
 Office Telephone: 215.533.3118
 Other:
 Rep: Rob Hamerski

Flashings: M.B. ☐
 Perimeter: M.B. ☐
 Walls: LI ☐
 Curbs: LI ☐
 Pitch Pans: Lead ☐
 Tie-ins: Cement ☐
 Interply Matl. Rate: 25 gals/sq Flood Coat: gals/sq
 Kettle Temp.: N/A a.m. / at p.m.

Daily Activity and General Notes:

LAST Section of new roof tear off completed today. Metal Deck was checked by me and Cliff from T.T.I. Environmental INC. Deck was VACUUMED AND PASSED Cliff Inspection
 Roofers (1) Clean deck (2) INSTACE 8x4 (2 sections) of metal decking, Mech. ATTACHED Per Spec (3) INSTACE 2 Layers of 2.5 ISO, Sump drains, INSTACE 1/2" Brown Board with Oli Bond, ADHERE Crickets with Oli bond. Clean & Broom ISO. INSTACE 1 ply of Power Ply Premium in Power Ply Standard Cold Adhesive

Contractor: 5622

Inspector: Jim [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative
 Form 6131 Rev. 1/06



WTI DAILY FIELD REPORT

WORK ORDER #: 9487844
PROJECT INFORMATION:
Date: 10-6-17 # of Days Worked 12 of _____
Is This Full-time Inspection? ☒ Yes ☐ No
Are Inspection Days Complete? ☐ Yes ☒ No
Project Name: Pinelands High School
Location: Little Egg Harbour N.J.
Roof Designation: 10.4.8
Weather: HOT 78°
Owner Rep: Bob Simmina
Telephone: 886-425-8888
Present at Site: Mike Kobuthen
Start Time: 7:00 Stop Time: _____

ROOFING SYSTEM INFORMATION: Spec
Preparation: Remove ☐
Deck Type: Metal ☐
Priming: W.B ☐
Wood Blocking: P.T ☐
Cant: Fiber Vapor Retarder: N/A ☐
Insulation Type: I.S.O Thickness: 5 " ☐
Attachment: Mech ☐
Second Layer Type: Brown Thickness: 1/2" ☐
Attachment: BOARD ole bond ☐
Daily Waterstop: Cemca T ☐
Roof System: Power Ply ☐

CONTRACTOR INFORMATION:
Name: Mike Kobuthen
Contact: Bob Law
Foreman: Steve Young, Franky B
Crew Size: 20 FLOOD
Office Telephone: 215 533 3118
Other: _____
Rep: Rob Hamerski

Flashings: M.B ☐
Perimeter: MB ☐
Walls: 11 ☐
Curbs: 11 ☐
Pitch Pans: LEAD ☐
Tie-ins: Cement ☐
Interply Matl. Rate: 2.5 gals/sq Flood Coat: _____ gals/sq
Kettle Temp.: _____ at _____ a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

This is the 5th day this school has been shut down, for Air testing. there has been 35 tests done for Asbestos by T.T.I Environmental, INC. Air tests show high levels of benzine, low Asbestos (1) part.
Put a call into Supervisor Mike Jones today. Masons want to clean new bricks with SAFE CLEAN. I no nothing about this product, so was told to contact Josh Toole from Cleveland office. Left message on his Answer Machine. I mark several fish mouths on Roof 8:10. Roover cut and Patch as they install the Power Ply

Contractor: St B

Inspector: Jim [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
Pink - Owner Gold - Tremco Representative
Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9487844

PROJECT INFORMATION:

Date: 10/7/17 # of Days Worked 13 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pine Lands H. School

Location: Little Egg Harbour, N.J.

Roof Designation: 8.10

Weather: Unseasonably Hot 80°

Owner Rep: Bob Simmino

Telephone: 886-425-8888

Present at Site: Mike Kobithen

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Kobithen Roofing

Contact: Bob Low

Foreman: F. Bramm, Steve Young, Floyd

Crew Size: 24

Office Telephone: 215-533-3118

Other:

Rep: Rob Hameensky

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: W.B. ☐Wood Blocking: P.T. ☐Cant: Fiber Vapor Retarder: N/A ☐Insulation Type: D.S.O. Thickness: 5" ☐Attachment: Mech. ☐Second Layer Type: Brown Thickness: 1/2" ☐Attachment: Oil based ☐Daily Waterstop: Cement ☐Roof System: Power Ply ☐Flashings: M.B. ☐Perimeter: " ☐Walls: " ☐Curbs: " ☐Pitch Pans: LEAD ☐Tie-ins: Cement ☐

Interply Matl. Rate: 25 gals/sq Flood Coat: gals/sq

Kettle Temp.: N/A a.m. / at p.m.

Daily Activity and General Notes:

SAT. - WALKED ALL ROOF LEVELS AND MARKED NUMEROUS AREAS FOR REPAIR. 24 ROOSTERS COMPLETE ROOF CO, COMPLETE INSTALLATION OF POWER PLY SUPREME F.R. WALLS where hung and 4 curbs flashed, Field Seams started to weld. 100% Load. Kids scheduled to return Mon. HEAVY Rain expected

Contractor: STB

Inspector: J. J. J.

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

JOSH - TOOLE - 216-766-5581

WTI DAILY FIELD REPORT

WORK ORDER #: 9487844
 PROJECT INFORMATION:
 Date: 10/9/17 of Days Worked 14 ^{3 hrs} of
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Little Egg Harbor NJ
 Location: Pine Lands H. Schul
 Roof Designation: 4
 Weather: Nico
 Owner Rep: Bob Simmiro
 Telephone: 886 425 8888
 Present at Site: Alex Wagner
 Start Time: 7.00 Stop Time: 10.00

CONTRACTOR INFORMATION:

Name: Mike Kobithin Roofing
 Contact: Bob Law
 Foreman: Steve Young
 Crew Size: 20
 Office Telephone: 25.533.3118
 Other:
 Rep: Rob Hammesky

ROOFING SYSTEM INFORMATION: Spec

Preparation: Remov ☐
 Deck Type: metal ☐
 Priming: W.B ☐
 Wood Blocking: P.T ☐
 Cant: Fiber Vapor Retarder: N/A ☐
 Insulation Type: I.S.O Thickness: 5 " ☐
 Attachment: Mech. Fastening ☐
 Second Layer Type: Brown Thickness: 1/2 " ☐
 Attachment: Oil board ☐
 Daily Waterstop: Cement ☐
 Roof System: Power Ply ☐

Flashings: MB ☐
 Perimeter: " ☐
 Walls: " ☐
 Curbs: " ☐
 Pitch Pans: Lead ☐
 Tie-ins: Cement ☐
 Interply Matl. Rate: 2.5 gals/sq Flood Coat: gals/sq
 Kettle Temp.: at a.m. / at p.m.

Daily Activity and General Notes:

Arrived at job to hear we were
banned from using any adhesives on this site
when teachers and children are present. Roofers
switched Gears and set up for Heat welding.
Generators and equipment loaded on roof 4:45,
Chuck of New Road Construction Management was worried
about fumes had Generators lowered back down. Ran
more cords, starting welding saw some smoke and stopped
Roofers from welding. Roofers have been welding for
the 14 days I've been here with no complaints??

Contractor: _____

Inspector: Jim Hunt

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 94 87844
 PROJECT INFORMATION:
 Date: 10/12/17 # of Days Worked 14 1/2 of _____
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Pinelands H. School
 Location: Little Egg Harbour N.J.
 Roof Designation: ALL
 Weather: RAIN & WIND
 Owner Rep: Bob Simmino
 Telephone: 886-425-8888
 Present at Site: Alex Wagner
 Start Time: 7:00 Stop Time: _____

CONTRACTOR INFORMATION:

Name: Mike Kobothin Roofing
 Contact: Bob Law
 Foreman: Steve Gamm
 Crew Size: Rain Day
 Office Telephone: _____
 Other: _____
 Rep: _____

ROOFING SYSTEM INFORMATION: Spec
 Preparation: _____ ☐
 Deck Type: _____ ☐
 Priming: RAIN ☐
 Wood Blocking: DAY ☐
 Cant: _____ Vapor Retarder: _____ ☐
 Insulation Type: _____ Thickness: _____ " ☐
 Attachment: _____ ☐
 Second Layer Type: _____ Thickness: _____ " ☐
 Attachment: _____ ☐
 Daily Waterstop: _____ ☐
 Roof System: _____ ☐
 Flashings: Rain ☐
 Perimeter: DAY ☐
 Walls: _____ ☐
 Curbs: _____ ☐
 Pitch Pans: _____ ☐
 Tie-ins: _____ ☐
 Interply Matl. Rate: _____ gals/sq Flood Coat: _____ gals/sq
 Kettle Temp.: _____ at _____ a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

Rain Day! Received a call from
Rep Rob Hanery to see if I could go to site and meet
with George W. Loner, CSP the director of Environmental,
Health and Safety for Tremco. Met with George, showed
him the roof and location where smell was last week.
We then went into school and introduced George to Rich
Head of facilities for Pinelands Regional School District.
George will write his report and send to all interested
PARTYS

Contractor: StB

Inspector: Jeri Stewart

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative

WTI DAILY FIELD REPORT

WORK ORDER #: ~~9487844~~ 9487844

PROJECT INFORMATION:

Date: 10/13/17 # of Days Worked 15 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pinelands Regional School District

Location: Little Egg Harbor N.J.

Roof Designation: MC

Weather: Cloudy 66°

Owner Rep: Bob Simmons

Telephone: 886-425-8888

Present at Site: M. Kobithin,

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobithin Roofing

Contact: Bob Law

Foreman: Steve Young

Crew Size: 16

Office Telephone: 215-523-3118

Other:

Rep: Rob Hammersky

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: L.B. ☐Wood Blocking: P.T. ☐Cant: fiber Vapor Retarder: n/a ☐Insulation Type: F.S.D Thickness: 5" ☐Attachment: mech. ☐Second Layer Type: Bram Thickness: 1/2" ☐Attachment: Ol. bond ☐Daily Waterstop: Cement ☐Roof System: Power Ply ☐Flashings: M.B. ☐Perimeter: " ☐Walls: " ☐Curbs: " ☐Pitch Pans: LEAD ☐Tie-ins: 2 ply ☐

Interply Matl. Rate: 2.5 gals/sq Flood Coat: gals/sq

Kettle Temp.: N/A a.m. / at p.m.

Daily Activity and General Notes:

School has been ~~shut~~ shut down again

today. This allows us to continue to roof. 4 men work

all Roof levels and clean all debris, from roofs. 4 men

work on Heat welding field Joints on Roof 4m5 On Roof

that abuts Gym roof. 5 men install Power Ply. I instruct men

that areas where Equip was stacked on stained the roof. These

Areas will have to be primed with Asphalt Primer.

Instructed Carpenters to Protect Roof. Numerous fish mouths

and mole runs were repaired before Power Ply installation

Contractor: St. Ben

Inspector: Jim Hunt

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 94782844

PROJECT INFORMATION:

Date: 10/17/17 # of Days Worked 16 of _____Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pine Lands Regional School Dist.Location: Little Egg Harbour N.J.Roof Designation: Science Wing, 4-5Weather: Frost to SunOwner Rep: Bob SimmanTelephone: 886-425-8888

Present at Site: _____

Start Time: 7:00 Stop Time: _____

CONTRACTOR INFORMATION:

Name: Mike Kobithen RoofingContact: Bob LawForeman: Steve Young, Frank B. - Floyd

Crew Size: _____

Office Telephone: 215-533-3118

Other: _____

Rep: Bob Hammerky

ROOFING SYSTEM INFORMATION: Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: W.B. ☐Wood Blocking: R.P. ☐Cant: Fiber Vapor Retarder: N/A ☐Insulation Type: I-50 Thickness: 5 " ☐Attachment: Mech. ☐Second Layer Type: Brown Thickness: 1/2 " ☐Attachment: U-Bond ☐Daily Waterstop: Cement ☐Roof System: Power Ply ☐Flashings: M.B. ☐Perimeter: M.B. ☐Walls: M.B. ☐Curbs: M.B. ☐Pitch Pans: LEAD ☐Tie-ins: Cement 1 ply ☐Interply Matl. Rate: 2 gals/sq Flood Coat: _____ gals/sqKettle Temp.: N/A at _____ a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

Last week (THURSDAY) screw reportably fell from ceiling and struck student, ~~no~~ injuries, but we got knocked off pending investigation. For we return to work! Informed Mike Jones of event.

Instruct Brick Layers and Carpenters to lay down Roof Protection, which they did. On Science Wing roofers rid Roofs of Frost, then lay out power ply. After Relaxing Sheets Roofer Lay field on 1/2 the roof. I meet with carpenters and instruct approx. 6 Curbs. Curbs measure 2". All Sheets rolled with rollers. Heat welding on roof.

Contractor: SKBInspector: Jan J. [Signature] 4/15

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 94727844
 PROJECT INFORMATION:
 Date: 10/19/17 # of Days Worked 17 of
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Pine Islands Regional Schools
 Location: Little Egg Harbour N.J.
 Roof Designation: 4.5. SCIENCE Wing
 Weather: 70° Frost
 Owner Rep: Bob Sammano
 Telephone: 886.425.8888
 Present at Site: _____
 Start Time: 7.00 Stop Time: _____

CONTRACTOR INFORMATION:
 Name: Mike Kob, Thin Roofing
 Contact: Bob Law
 Foreman: Steve Young, Floyd
 Crew Size: 24
 Office Telephone: 215.533.3118
 Other: _____
 Rep: Rob Hammeraki

ROOFING SYSTEM INFORMATION: Spec
 Preparation: Remove ☐
 Deck Type: Metal ☐
 Priming: W.B ☐
 Wood Blocking: P.T ☐
 Cant: Fiber Vapor Retarder: N/A ☐
 Insulation Type: I.J.O Thickness: 5 " ☐
 Attachment: Mech. ☐
 Second Layer Type: Broad Thickness: 1/2 " ☐
 Attachment: Board subond ☐
 Daily Waterstop: 2 ply ☐
 Roof System: 1 ply Power Ply ☐
 Flashings: M.B ☐
 Perimeter: " ☐
 Walls: " ☐
 Curbs: " ☐
 Pitch Pans: LEAD ☐
 Tie-ins: Cement ☐
 Interply Matl. Rate: _____ gals/sq Flood Coat: _____ gals/sq
 Kettle Temp.: _____ at _____ a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

On Roof: Science Wing Roofers dry
 an Scrap Roof. Continue to Lay Power Ply Cap Sheet.
 I Put a Call into Sales Rep. Rob Hammeraki. On all
 Areas where wall work is being completed. Will need
 to be coated with W.B Primer, there is none on site.
 We will need primer in 4 days. On these Areas, Areas
 to be cleaned, Primed and another base ply Added where
 necessary. I Probe Seams (FiscD) on End Curbs. mark minimal
 Area for Repair. Roofers Complete Repair Work, behind me
 Dog removed and crew begins work on Area 4

Contractor: ITB

Inspector: Jim J...

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative
 Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: ~~9478~~ 9492047

PROJECT INFORMATION:

Date: 10/19/17 # of Days Worked 18 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pine Land Regional School

Location: Little Egg Harbor N.J.

Roof Designation: Science Wing + 4

Weather: Nice 70°

Owner Rep: Bob Simmino

Telephone: 886-425-8888

Present at Site: Mike Kobethin, Bob S.

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobethin Roofing

Contact: Bob Law

Foreman: Steve Young, Floyd

Crew Size: 20

Office Telephone: 215-533-3118

Other:

Rep: Rob Hammerky

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Completed ☐Deck Type: Metal ☐Priming: W.O. ☐Wood Blocking: P.T. ☐Cant: Fiber Vapor Retarder: M/A ☐Insulation Type: B.F.O. Thickness: 5" ☐Attachment: Mech. Fasteners ☐Second Layer Type: GFI Thickness: 1/2" ☐Attachment: Oil bond ☐Daily Waterstop: Power Ply ☐Roof System: Power Ply ☐Flashings: M.B. ☐Perimeter: C ☐Walls: C ☐Curbs: C ☐Pitch Pans: ☐Tie-ins: Power Ply ☐

Interply Matl. Rate: 2.5 gals/sq Flood Coat: gals/sq

Kettle Temp: M/A at a.m. / at p.m.

Daily Activity and General Notes:

Bob Simmino on Science Wing voices

Concern about missing crickets. I showed him we are installing missing crickets before we install finish Cap Sheet. I punch out Roof 4 mark 3 AREAS for Repair. Order more primer, this from Mike Kobethin.

We continue to Lay finish Power Ply Cap. Sheet.

School Gives Company 1 week to Complete. Students still not attending school. Don't no how this job will get finished as long as kids are present

Contractor: St B

Inspector: Jan Flatt

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 10/29/17 # of Days Worked 19 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☐ NoProject Name: PINELANDS Regional H. SchoolLocation: Little Egg Harbour, N.J.Roof Designation: Science Wing 4, 7Weather: 70°sOwner Rep: Bob SimmiroTelephone: 886.425.8888

Present at Site:

Start Time: 7.00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobothin RoofingContact: Bob LawForeman: Steve Young, FloydCrew Size: 22Office Telephone: 201.533.3118

Other:

Rep: Bob Thamer sky

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: V.B. ☐Wood Blocking: P.V. ☐Cant: Fiber Vapor Retarder: N/A ☐Insulation Type: ISO Thickness: 5" ☐Attachment: Mech ☐Second Layer Type: Brant Thickness: 1/2" ☐Attachment: Hot - old bond ☐Daily Waterstop: Power Ply ☐Roof System: Power Ply ☐Flashings: M-B ☐Perimeter: " ☐Walls: " ☐Curbs: " ☐Pitch Pans: Loam ☐Tie-ins: Power Ply ☐Interply Matl. Rate: 2 gals/sq Flood Coat: 2 gals/sqKettle Temp.: N/A at 11 a.m. / 11 at 11 p.m.

Daily Activity and General Notes:

On Science Wing, Roofers Continue to lay out the Powerply Cap Sheet, Underneath Lg. Unit on on sleepers several plys were put in to try to Alluvate the Ponding Water. 30' of wall that was not flashed with the Power Ply Base was flashed today. Roofers own a 8" strip off Base Sheet on Riving wall to Gym. On lower Roof Perimeter Walls are installed and Numerous Curbs Flashed with Power Ply Cap.

Contractor: STBInspector: Jim Stewart

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 10-21-17 # of Days Worked 20 of Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: PINELANDS Reg. H. SchoolLocation: Little Egg Harbour N.J.Roof Designation: 10. Science FrontWeather: Fog to Sun 72°Owner Rep: Bob SimmonsTelephone: 215.533.3118Present at Site: Bob SimmonsStart Time: 7.00 Stop Time:

CONTRACTOR INFORMATION:

Name: Kibithen RoofingContact: Bob LowForeman: Steve Young - FloydCrew Size: 12Office Telephone: 215.533.3118Other: Rep: R. Homensky

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: W.B. ☐Wood Blocking: P.T. ☐Cant: Fiber Vapor Retarder: N/A ☐Insulation Type: I.S.O. Thickness: 5" ☐Attachment: Mech. ☐Second Layer Type: Board Thickness: 1/2" ☐Attachment: Hot. Board ☐Daily Waterstop: Power Ply ☐Roof System: Power Ply ☐Flashings: M.B. ☐Perimeter: M.B. ☐Walls: M.B. ☐Curbs: M.B. ☐Pitch Pans: Lead ☐Tie-ins: Power Ply ☐Interply Matl. Rate: 2 Gals/sq Flood Coat: gals/sqKettle Temp.: N/A at a.m. / at p.m.

Daily Activity and General Notes:

Free is completed with the Power Ply on Science Wing. Flashing continues on curbs. On Rising wall Base Sheet ends below Dens Glass. He will add a 8" sheet of Base to correct. Roof area near wall was inspected and I found no holes or openings OK to run Power Ply over in this area. Roofing on Front Low Roof install Curry treads and portion A.C. units on Wood Sleepers. 2 A.C. units positioned. Roof 10: was checked, 6' Back from wall was primed along with any stained areas. Roof will be laid on Sun.

Contractor: St BInspector: Jim J

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 10.22.17 # of Days Worked 21 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☐ No

Project Name: Pine Land, Reginald H.

Location: Little Egg Harbor N.J.

Roof Designation: Service Wing - Front. 10

Weather: Fog to Sun 76°

Owner Rep: Bob Simmino

Telephone: 215.533.318

Present at Site: Bob Simmino

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Kathleen Brown

Contact: Bob Law

Foreman: Steve Brown

Crew Size: 18

Office Telephone: 215.533.3118

Other:

Rep: R. Hamanski

ROOFING SYSTEM INFORMATION: Spec

Preparation: Remove ☐Deck Type: metal ☐Priming: ~~WAS~~ Asphalt ☐Wood Blocking: P.T. ☐Cant: fiber Vapor Retarder: n/a ☐Insulation Type: I.S.D. Thickness: 8" ☐Attachment: Mech. ☐Second Layer Type: Grom Thickness: 1/2" ☐Attachment: Hot - OLI Bond ☐Daily Waterstop: Power Ply ☐Roof System: Power Ply ☐Flashings: M/B ☐Perimeter: 21 ☐Walls: 7 ☐Curbs: 11 ☐Pitch Pans: Lead ☐Tie-ins: Power Ply ☐

Interply Matl. Rate: 2.5 gals/sq Flood Coat: gals/sq

Kettle Temp.: N/A a.m. / at p.m.

Daily Activity and General Notes:

Roof 10: Approx 2' of Power Ply
Cap Sheet was laid in Power Ply standard Cold Adhesive,
all sheets, on every roof level have been rolled with
Heavy Duty Roller.

Lower Roof: Heat welding continues on Curbs and field
Seams.

Service Roofs: Heat welding continues
on Roof 3

Contractor: S. Brown

Inspector: Joe Stent

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date 10/23/17 # of Days Worked 22 of _____Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pine Lands Regional H. SchoolLocation: Little Egg Harbour, NJ.Roof Designation: 2.3.10Weather: Cloudy 72° to RainOwner Rep: Bob SimmivoTelephone: 215-533-3118 425-8888Present at Site: SimmivoStart Time: 2:00 Stop Time: _____

CONTRACTOR INFORMATION:

Name: Kobrother RoofingContact: Bob LawForeman: STEVE BROWNCrew Size: 20Office Telephone: 215-533-118

Other: _____

Rep: R. Hamesky

ROOFING SYSTEM INFORMATION: Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: W.B ☐Wood Blocking: P.T ☐Cant: Fiber Vapor Retarder: N/A ☐Insulation Type: I-50 Thickness: 5 " ☐Attachment: Mech. ☐Second Layer Type: Gum Thickness: 1/2 " ☐Attachment: Hot - Olibond ☐Daily Waterstop: Power Ply ☐Roof System: Power Ply ☐Flashings: M.B ☐Perimeter: M.B ☐Walls: M.B ☐Curbs: 1' ☐Pitch Pans: LEAD ☐Tie-ins: Power Ply ☐Interply Matl. Rate: 2 gals/sq Flood Coat: _____ gals/sqKettle Temp.: _____ at 10 a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

Roof 10: Approx. 35% was completed to complete Power Ply Cap-Sheet. Walls were cut to size and installed. On 1 ply base going up wall, AREA blistered out, along this wall these Areas were cut and cemented, an NEW strip of base applied, this was also done on roof 2.3.

On top roof's Flashing work continues, and heat welding equip move to these roofs. Dog is being run on fire Seams and Hand welding on Curbs. I probe an inspect Lower Roofs. mark Several Voids for Repair, which were completed.

Contractor: S. BrownInspector: Sam J. Hamesky

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 10/25/17 # of Days Worked 23 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: PINELANDS REGIONAL School DIST.

Location: Little Egg Harbour, N.J.

Roof Designation: ~~Class 1~~ 10.3.6

Weather: Cloudy, Cool, 66°

Owner Rep: Bob Simmino

Telephone: 866-425-8888

Present at Site: Simmino - M. Kobithen

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobithen Roofing

Contact: Bob Law

Foreman: Steve Brown - Floyd

✓ Crew Size:

Office Telephone: 215-533-3118

Other:

Rep: Rob Hammerski

ROOFING SYSTEM INFORMATION: Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: Asphalt ☐Wood Blocking: P.T. ☐Cant: Fiber Vapor Retarder: N/A ☐Insulation Type: I.S.O Thickness: 5" ☐Attachment: Mech. ☐Second Layer Type: Brown Thickness: 1/2" ☐Attachment: Hot - Ol. bond ☐Daily Waterstop: Power Pln ☐Roof System: Power Ph ☐Flashings: M.B. ☐Perimeter: 1) ☐Walls: 2) ☐Curbs: 3) ☐Pitch Pans: LEAD ☐Tie-ins: Power Ph ☐

Interply Matl. Rate: 25 gals/sq Flood Coat: gals/sq

Kettle Temp.: N/A at a.m. / at p.m.

Daily Activity and General Notes:

Checked on a spec. with Supervisor Mike Jones, Architects' spec. shows Trem Tape on Turn bar, was told to go with Architects drawing. On Roof 9, where SCAFO LP was installed on ply wood, Ply wood Removed, Area swept clean.

I inspect this area and find no holes, or tears in power ply base sheet. Area was primed with asphalt primer

On Roof 10: 4 small Curbs 2"x2", were Reason Using P.T. wood.

Contractor: Sogor

Inspector: Jon J. A.

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047
 PROJECT INFORMATION:
 Date: 10/26/17 # of Days Worked 24 of 24
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Pinelands Regional School Dist
 Location: Little Egg Harbor, N.J.
 Roof Designation: PK-8-1-12-10
 Weather: Cool 45° - 65°
 Owner Rep: Bob Simmino
 Telephone: 866-425-8888
 Present at Site: M. Kobithin, Bob Simmino
 Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobithin Roofing
 Contact: Bob Law
 Foreman: STEVE BROWN, FLOYD
 Crew Size: 26
 Office Telephone: 215-533-3118
 Other:
 Rep: Rob Hamersky

ROOFING SYSTEM INFORMATION: Spec
 Preparation: REMOVE ☐
 Deck Type: Metal ☐
 Priming: Asphalt ☐
 Wood Blocking: P.T. ☐
 Cant: Fiber Vapor Retarder: N/A ☐
 Insulation Type: ISO Thickness: 5 " ☐
 Attachment: Mech. ☐
 Second Layer Type: Brown Thickness: 1/2 " ☐
 Attachment: Hot Oilband ☐
 Daily Waterstop: Power ply ☐
 Roof System: Power ply ☐

Flashings: M.B. ☐
 Perimeter: " ☐
 Walls: " ☐
 Curbs: " ☐
 Pitch Pans: LEAD ☐
 Tie-ins: Power ply ☐
 Interply Matl. Rate: 2.5 gals/sq Flood Coat: gals/sq
 Kettle Temp.: N/A a.m. / at p.m.

Daily Activity and General Notes:

Roof Area 12 FLASHING WORK CONTINUES
 4 Curb Vents in process of Heat Welding. Roof Area 10 (where Scaffolds Set Up.) Approx 50'x28" Inspected and Primed.
 Roof Area 3: Men continue flashing of curbs, Pipes and chimney. 2 dogs running on Field Seams. Roof area complete will inspect and Probe tomorrow. On wacc 7 approx 20' of Power Ply Cap sheet was installed, wall was not run all the way up under Dens Glass. These wacc unacceptable will be removed and new waccs installed, per. Brooks Garrison's Spec

Contractor: SKB

Inspector: Jim Standa

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative
 Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 10.27.17 # of Days Worked 25 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☐ NoProject Name: Pine lands Rec. H. SchoolLocation: Little cgg Harbour, N.SRoof Designation: 3.4.5.10Weather: Cool 46° to 65°Owner Rep: Bob SimmarioTelephone: 866.425.8888Present at Site: Brooks, M. Kobithin B. SimmarioStart Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobithin RoofingContact: Bob LawForeman: Steve Brown, FLOYDCrew Size: 25Office Telephone: 215.533.3118

Other:

Rep: R. Hamersky

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Remove ☐Deck Type: metal ☐Priming: Alpha H ☐Wood Blocking: P.T ☐Cant: Fiber Vapor Retarder: 1/2" ☐Insulation Type: I.S.O Thickness: 5" ☐Attachment: mech. ☐Second Layer Type: Brown Thickness: 1/2" ☐Attachment: Hot Oilband ☐Daily Waterstop: Power Ply ☐Roof System: Power Ply ☐Flashings: M.S ☐Perimeter: LI ☐Walls: LI ☐Curbs: LI ☐Pitch Pans: Lead ☐Tie-ins: Power Ply ☐Interply Matl. Rate: 2.5 gals/sq Flood Coat: gals/sqKettle Temp.: N/A a.m. / at p.m.

Daily Activity and General Notes:

Rob Hamersky, Brooks Ganway, Bob Simmario, Bob and Mike Kobithin walk roof today.
I probe all field seams, and vertical seams, Mark Areas for Repair, on Roof Area 3. Detail on Window Wall will have to find out from Supervisors what they want, and how to flash these areas have only approx 3" from deck to wall. Alpha Guard? On Gym Roof 2 curbs still need to be raised - 2 rollers flush inner roof. Flashing 2 Rail Curbs and repairing wall Sheet Flashing. Because of heavy frost on Roof 8, No Cap Sheet installed they work on Flashing

Contractor: SRInspector: Jim Smith

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 10.30.17 # of Days Worked 23 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: PINELANDS REGINALLocation: Little Egg Harbour, NJRoof Designation: ALLWeather: Breezy Cool, Sunny 5-70Owner Rep: Bob SimminoTelephone: 425.8888Present at Site: Jerry Flowers, Rob HamerskyStart Time: 2.00 Stop Time: _____

CONTRACTOR INFORMATION:

Name: Kobithen RoofingContact: Bob LawForeman: Steve Brown, FloydCrew Size: 19Office Telephone: 215.533.1118

Other: _____

Rep: R. Hamersky

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: Asphalt ☐Wood Blocking: P.T. ☐Cant Fiber Vapor Retarder: N/A ☐Insulation Type: ES-0 Thickness: 4.5" ☐Attachment: Mech. ☐Second Layer Type: Brown Thickness: 1/2" ☐Attachment: HOT - OIL BOUND ☐Daily Waterstop: Power Ply ☐Roof System: Power Ply ☐Flashings: M.B ☐Perimeter: M.B ☐Walls: M.B ☐Curbs: M.B ☐Pitch Pans: LEAD ☐Tie-ins: Power Ply ☐Interply Matl. Rate: 2 gals/sq Flood Coat: _____ gals/sqKettle Temp.: Nat a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

On SITE today; Jerry Flowers, Rob Hamersky, Mike Kobithen, Alex, Brooks Garrison, and New Roads Bob, Jerry, we all walk ALL Roof Levels. Brooks Garrison complains about shoddy work, blisters, an Roof Marked up. Wants Roof it 11 tone off, or he won't pay or sign off on it.

We will wait for Meeting Jerry will have with Vince Paladino, to get answers. I think Rob is fine along with Rob Hamersky, also agrees.

Contractor: S + SInspector: Jerry Flowers

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047
 PROJECT INFORMATION:
 Date: 11-1-17 # of Days Worked: 24 of 25
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Amelands Rem. w/
 Location: Little Egg Harbour, N.J.
 Roof Designation: 1-6-11
 Weather: Clouds - 60°
 Owner Rep: Bob Summers
 Telephone: 425-1118
 Present at Site: Alex
 Start Time: 7:00 Stop Time: _____

ROOFING SYSTEM INFORMATION: Spec
 Preparation: Remove ☐
 Deck Type: Metal ☐
 Priming: Asphalt ☐
 Wood Blocking: P.T ☐
 Cant: Fiber Vapor Retarder: n/a ☐
 Insulation Type: I.S.D Thickness: 5" ☐
 Attachment: Mech. ☐
 Second Layer Type: Brown Thickness: 1/2" ☐
 Attachment: Ol. bond - +10T ☐
 Daily Waterstop: Power Ply ☐
 Roof System: 11 ☐

CONTRACTOR INFORMATION:
 Name: Kobithen Roofing
 Contact: Bob Law
 Foreman: Steve Brown - Floyd
 Crew Size: 20
 Office Telephone: 215-533-1118
 Other: _____
 Rep: Rob Harneski

Flashings: M.B ☐
 Perimeter: " ☐
 Walls: " ☐
 Curbs: " ☐
 Pitch Pans: LEAD ☐
 Tie-ins: Power Ply ☐
 Interply Matl. Rate: 2.5 gals/sq Flood Coat: _____ gals/sq
 Kettle Temp.: N/A a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

on yesterday's report. I stated Brooks Garrison wanted roof 11 tore off. Report should read he will not sign off on that roof level. Tremco's Terri Flowers will meet with Reps. in Cleveland and make a decision. On Roof 11 2 pitch pockets and 1 pipe removed. Pitch Pockets cut out and new Ins. Installed, along with new base Sheet. On Gym roof welds perimeter wall. Walls not enough material on deck to do with the day, so work has to be done by hand. Roof 8, over main lobby entrance. Scaff removed, base inspected and found in Good Shape, Area Primed, and white Caped. All Sheets rolled.

Contractor: _____

Inspector: Jon J. H. A.

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative
 Form 6131 Rev. 1/06

WTL DAILY FIELD REPORT

WORK ORDER #: 9492047
 PROJECT INFORMATION:
 Date: 1/2/17 # of Days Worked 25 of 26
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Pine Land's Regional School Dist
 Location: Little Egg Harbour, N.J.
 Roof Designation: 1-6-11
 Weather: WARM SUNNY - 70°
 Owner Rep: Bob Simonino
 Telephone: 425-1118
 Present at Site: _____
 Start Time: 7.00 Stop Time: _____

ROOFING SYSTEM INFORMATION: Spec
 Preparation: Remove ☐
 Deck Type: Metal ☐
 Priming: Asphalt ☐
 Wood Blocking: P.T. ☐
 Cant: fib Vapor Retarder: N/A ☐
 Insulation Type: ISO Thickness: 5" ☐
 Attachment: Mech. ☐
 Second Layer Type: Brown Thickness: 1/2" ☐
 Attachment: HOT - Oli bond ☐
 Daily Waterstop: Power Ply ☐
 Roof System: 11 ☐

CONTRACTOR INFORMATION:

Name: Kobithen Roofing
 Contact: Bob Law
 Foreman: Bob Brown
 Crew Size: 20
 Office Telephone: 215-533-1118
 Other: _____
 Rep: Rob Hamersky

Flashings: MB ☐
 Perimeter: 11 ☐
 Walls: 11 ☐
 Curbs: 11 ☐
 Pitch Pans: LEAD ☐
 Tie-ins: Power Ply ☐
 Interply Matl. Rate: 2.5 gals/sq Flood Coat: _____ gals/sq
 Kettle Temp.: N/A a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

Between YESTERDAY and today, I probe roof's 1-2-3. Mark several AREAS for Repair. Roofer follows behind to make the repairs.

Roof 11, SCAFFOLD removed from Side Wall. I check base Sheet for ANY defects, find none. Instruct Rafter on what AREAS have to be primed, 1 drain is off center. Work with Foreman Steve Brown to add several Sheets, to low spots to shed water to the drain, will check After next Rain. I call Supervision to inform I will not be on Site Fri, leaving for weekend.

Contractor: S. Bn

Inspector: Jim

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

I CALLED him on MON.

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11.6.17 # of Days Worked 28 of 28

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pinelands Regional School

Location: Little Egg Harbour, N.J.

Roof Designation: 11.10.9

Weather: Cloudy to Rain

Owner Rep: Bob Simmario

Telephone: 425 8888

Present at Site:

Start Time: 7.00 Stop Time:

CONTRACTOR INFORMATION:

Name: Kobithin Roofing

Contact: Bob Law

Foreman: Steve Brown, Floyd

Crew Size: 18

Office Telephone: 215.533.1118

Other:

Rep: Rob Hammersk.

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: Asphalt ☐Wood Blocking: P.T. ☐Cant: Eber Vapor Retarder: ☐Insulation Type: I.S.O. Thickness: 5" ☐Attachment: Mech. Fasten ☐Second Layer Type: Brown Thickness: 1/2" ☐Attachment: Hot. Dimpled ☐Daily Waterstop: Power Ply ☐Roof System: " " ☐Flashings: m.B. ☐Perimeter: " " ☐Walls: " " ☐Curbs: " " ☐Pitch Pans: Lead ☐Tie-ins: Power Ply ☐

Interply Matl. Rate: 25 gals/sq Flood Coat: gals/sq

Kettle Temp.: Nat A a.m. / at p.m.

Daily Activity and General Notes:

Roof 10: 2 or 3 weeks ago I recommended adding a drain to relieve ponding water. Was told today that this extra will not be done, because of expense. Also in this area there are 3 to 4, 4'x4' obsolete curb vents that will be removed next year. When new roof A.C. is installed. Also Every brick in this school has to be removed, so inspections can be done to structural I beams. Which means all new perimeter metal will have to be removed. Heat welding and flashing work continues on Roofs 11 & 10

Contractor: SGB

Inspector: Jim Huest

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11.7.17 # of Days Worked 29 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pinebluffs Regional CenterLocation: Little Egg Harbour, NJRoof Designation: 11/10 9.5 Small RoofWeather: Cloudy, Damp. 54°Owner Rep: Bob SimminoTelephone: 609.457.5998Present at Site: BobStart Time: 7:00 Stop Time: _____

CONTRACTOR INFORMATION:

Name: Kobithen HartingContact: Bob LawForeman: Steve BrownCrew Size: 20Office Telephone: 215.533.1118

Other: _____

Rep: Rob Flamerky

ROOFING SYSTEM INFORMATION: Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: Asphalt ☐Wood Blocking: P.T ☐Cant: Fiber Vapor Retarder: N/A ☐Insulation Type: I-50 Thickness: 5 " ☐Attachment: Nch Fastener ☐Second Layer Type: Brown Thickness: 1/2 " ☐Attachment: Hot, Oilbond ☐Daily Waterstop: Power Ply ☐Roof System: Power Ply ☐Flashings: M.B ☐Perimeter: " ☐Walls: " ☐Curbs: " ☐Pitch Pans: LEAD ☐Tie-ins: 1/2" Ply ☐Interply Matl. Rate: 5 gals/sq Flood Coat: _____ gals/sqKettle Temp.: N/A at 12 a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

Last Area on Roof 5, where the Scaffold was set up. Scaffold down, I check area, find 1 2" split in base sheet. Split was patched. An Area I marked was primed with Asphalt Primer. 2 skids of Power Ply I-1300 were delivered to site today. 2 Roofers work on last Area Roof 5 Installing Power Ply 300-FR. 2 roofers start small Roof Near Gym. Rest of crew on roofs 10, 11, continue to weld detail work. End of today Field Seams on these Roofs should be completed. I probe Roofs 10 mark few Areas for Repair.

Contractor: Se AInspector: Jim Jones

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11.8.17 # of Days Worked 30 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pinelands Regional Schools

Location: Little Egg Harbor, N.J.

Roof Designation: 9-10-11

Weather: Cloudy, Cool, 40°

Owner Rep: Bob Stanning

Telephone: 609-457-5998

Present at Site: M. Kobithin

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobithin Roofing

Contact: Bob Law

Foreman: STEVE Young - Floyd

Crew Size: 22

Office Telephone: 215-533-1118

Other:

Rep: Rob Hamesky

ROOFING SYSTEM INFORMATION: Spec

Preparation: ☐Deck Type: ☐Priming: ☒ CompleteWood Blocking: ☐Cant: ☐ Vapor Retarder: ☐Insulation Type: ☐ Thickness: ☐Attachment: ☐Second Layer Type: ☐ Thickness: ☐Attachment: ☐Daily Waterstop: ☐Roof System: Power Ply ☐Flashings: M.B. ☐Perimeter: 11 ☐Walls: 11 ☐Curbs: 11 ☐Pitch Pans: Low ☐Tie-ins: Power Ply ☐Interply Matl. Rate: 25 gals/sq Flood Coat: ☐ gals/sqKettle Temp.: N/A a.m. / ☐ at ☐ p.m.

Daily Activity and General Notes:

Architect Brooks Emmons is making Roofers add a 6" strip off of base sheet under Power Ply Cap Sheet to cover wood railer. This is not tremco Metal. Called Adam Woei from tremco, he informed me that I was rite, tremco requires Base Sheet to cover wood Railer. In this case the Power Ply Cap Sheet is covering wood railers Arch. wants 2 Plys under Metal. Meeting today results to be heard on Thurs.

Contractor: St R

Inspector: Jim J...

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11.9.17 # of Days Worked 31 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pineclands Regional SchoolLocation: Little Egg Harbor N.J.Roof Designation: AllWeather: 50°Owner Rep: Bob SimmivaTelephone: 609-457-5998Present at Site: Rob Hamersky, Brook Garrison

Start Time: Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobuthen RoofingContact: Bob LawForeman: Steve Brown, FloydCrew Size: 25Office Telephone: 215-533-1118

Other:

Rep: Rob Hamersky

ROOFING SYSTEM INFORMATION: Spec

Preparation: ☐Deck Type: ☐Priming: ☐Wood Blocking: ☐Cant: Vapor Retarder: ☐Insulation Type: Thickness: " ☐Attachment: ☐Second Layer Type: Thickness: " ☐Attachment: ☐Daily Waterstop: Power Ply ☐Roof System: 1" ☐Flashings: M.B. ☐Perimeter: M.B. ☐Walls: M.B. ☐Curbs: M.B. ☐Pitch Pans: Lead - Puma ☐Tie-ins: Power Ply ☐Interply Matl. Rate: 80 gals/sq Flood Coat: 80 gals/sqKettle Temp.: N/A a.m. / N/A at N/A p.m.

Daily Activity and General Notes:

Meeting with Brooks Garrison, Reps from New Roch., Mike Kobuthen, ACEX and Rob Hamersky. Architect Questions the coverage of the plys going down over wood nailer, we all walk and look under metal fascia and agree the plys are there!

Roofers Install the Power Ply to small roof in front of School. Heat weld all seams, On this roof the clearance from the roof to Counter Receiver, is 1" to 2", this wall will have to be flashed with Puma. Roofers then move to install the last of the power ply on roof 5. Power Ply has now been completed on this project! I probe roof 9 and mark for repair

Contractor: [Signature]Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Pink - Owner

Form 6131 Rev. 1/06

Yellow - Contractor

Gold - Tremco Representative

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11.10.17 # of Days Worked 32 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pine Lands Regional School Dist.Location: Little Egg Harbour N.J.Roof Designation: ALLWeather: Windy Cold, 30°SOwner Rep: Bob SimmTelephone: 609.457.5998

Present at Site:

Start Time: 7⁰⁰ Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Korthen RoofingContact: Bob LawForeman: Steve Brown - FloydCrew Size: 25Office Telephone: 215.533.1118

Other:

Rep: Rob Hunsley

ROOFING SYSTEM INFORMATION:

Spec

Preparation: ☐Deck Type: ☐Priming: Complete ☐Wood Blocking: ☐Cant: ☐ Vapor Retarder: ☐Insulation Type: ☐ Thickness: ☐Attachment: ☐Second Layer Type: ☐ Thickness: ☐Attachment: ☐Daily Waterstop: ☐Roof System: Power Ply ☐Flashings: M.B ☐Perimeter: M.B ☐Walls: M.B ☐Curbs: LI ☐Pitch Pans: Load - Puma ☐Tie-ins: Complete ☐Interply Matl. Rate: 2 gals/sq Flood Coat: ☐ gals/sqKettle Temp.: 11 PM a.m. / ☐ at ☐ p.m.

Daily Activity and General Notes:

Puma delivered early this week. Large turbo vents are being scraped and cleaned in ready for the Puma application this work on Gym Roof. Metal men's 2nd day installing Metal fascia snaps on top of wall. THIS IS NOT Tremco Metal. 5 Roofers on adutorum Roof making repairs previously marked by me 5 Roofers work on Water Roofing details.

Contractor: [Signature]Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11.12.17 # of Days Worked 33 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pinelands Regional School Dist.Location: Little Egg, Harbor N.J.Roof Designation: ALLWeather: 28° to 43°Owner Rep: Bob SummarioTelephone: 609.457.5998

Present at Site:

Start Time: 7.00 Stop Time:

CONTRACTOR INFORMATION:

Name:

Contact:

Foreman:

Crew Size: 26

Office Telephone:

Other:

Rep:

ROOFING SYSTEM INFORMATION: Spec

Preparation: ☐Deck Type: ☐Priming: Complete ☐Wood Blocking: ☐Cant: ☐ Vapor Retarder: ☐Insulation Type: ☐ Thickness: ☐Attachment: ☐Second Layer Type: JK Thickness: ☐Attachment: JK ☐Daily Waterstop: Power Ply ☐Roof System: Power Ply ☐Flashings: M.B ☐Perimeter: LI ☐Walls: LI ☐Curbs: LI ☐Pitch Pans: Lead - Puma ☐Tie-ins: ☐Interply Matl. Rate: 2.5 gals/sq Flood Coat: ☐ gals/sqKettle Temp.: N/A a.m. / ☐ at ☐ p.m.

Daily Activity and General Notes:

6 Turbo Vents on Seined Wing (INCOSELY) called Gym Yesterday. Where cleaned down to bare Metal. Base of vents and top, were taped off from primed. Mat was cut to fit and Adhered with Base Coat (Puma.) We have the top Coat that has to be, mixed with the Color. Called Sales Rep Rob Hamersky to find out the Ratio, Rafter Power Blow and Clean all debris, an equip., materials off of Roof. I probe the Remaining 6" of Power Ply, on roof 10.

HEAT welding count down on all Levels

Contractor: [Signature]Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11/12/17 # of Days Worked 34 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pinelands Regional School DistLocation: Little Egg Harbour, N.J.Roof Designation: Science Wing, 12.4Weather: 28° to 50°Owner Rep: Bob SimmivTelephone: 609. 457-5998

Present at Site:

Start Time: 7.00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kolathen RoofingContact: Bob LawForeman: Steve Brown - FLOYDCrew Size: 20Office Telephone: 215-533-1118

Other:

Rep: Bob Hammerky

ROOFING SYSTEM INFORMATION:

Spec

Preparation: ☐Deck Type: ☐Priming: Complete ☐Wood Blocking: ☐Cant: ☐ Vapor Retarder: ☐Insulation Type: ☐ Thickness: ☐Attachment: ☐Second Layer Type: ☐ Thickness: ☐Attachment: ☐Daily Waterstop: Power Ply ☐Roof System: Power Ply ☐Flashings: MB ☐Perimeter: " ☐Walls: " ☐Curbs: " ☐Pitch Pans: Lead, Puma ☐Tie-ins: Power Ply ☐Interply Matl. Rate: 2.5 gals/sq Flood Coat: ☐ gals/sqKettle Temp.: 175 at 11 a.m. / ☐ at ☐ p.m.

Daily Activity and General Notes:

Children still not in this School.
 This project the roofing end is supposed to be complete by Wed. Rain expected mon., even if it doesn't rain I doubt this will be completed. I complete probing of all seams on this 4 acre project. On Science Wing application of the Puma base as finish coat will be completed by days end. Roofers move to gym and then to Roof 4. On high roof, roofers fix all voids I marked. Clean up of all Roofs countwires.
 1400' of the edge metal. Installed to date

Contractor: [Signature]Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11-14-17 # of Days Worked 35 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pine lands Regional School DistLocation: Little Egg Harbour, N.J.Roof Designation: ALLWeather: 34° - 50°Owner Rep: Bob SummidoTelephone: 609.457.5988

Present at Site: _____

Start Time: 7:00 Stop Time: _____

CONTRACTOR INFORMATION:

Name: Mike Kobothin RoofingContact: Bob LawForeman: Steve Brown & FloydCrew Size: 20Office Telephone: 215.533.1118

Other: _____

Rep: Rob Hamersky

ROOFING SYSTEM INFORMATION:

Spec

Preparation: _____ ☐Deck Type: _____ ☐Priming: Complete ☐Wood Blocking: _____ ☐Cant: _____ Vapor Retarder: _____ ☐Insulation Type: _____ Thickness: _____ " ☐Attachment: _____ ☐Second Layer Type: _____ Thickness: _____ " ☐Attachment: _____ ☐Daily Waterstop: Power Ply Complete ☐Roof System: Power Ply ☐Flashings: M.B. ☐Perimeter: M.B. ☐Walls: M.B. ☐Curbs: M.B. ☐Pitch Pans: LEAD - Pump ☐Tie-ins: Completed ☐Interply Matl. Rate: 2.5 gals/sq Flood Coat: _____ gals/sqKettle Temp.: N/A a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

3rd Floor Roof: Roofers Continue to Repair all marks I cricle on Roof. 3 Large Curb Forms Raised. Because existing Curbs too small for Unit, Carpenters will have to fabricate Lg. Cant to Insure Smooth Transition, there is 1 Vent Curb in Front small Roof Also has to be done. Was informed that small drop down roof on Science wing, All bricks on wall will be covered with power-ply. On all drains near Walls Pump has been mixed, and mesh laid in Base, covering all vertical Seams, then Top Coated Per spec.

Contractor: [Signature]Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047
 PROJECT INFORMATION:
 Date: 11.18.17 # of Days Worked 36 of
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Pinebluffs Regional School Dist
 Location: Little Egg Harbour
 Roof Designation: 3-2-1-9-5
 Weather: Cloudy 50°
 Owner Rep: Bob Simmons
 Telephone: 609-457.5988
 Present at Site: Alex
 Start Time: 7.00 Stop Time: _____

ROOFING SYSTEM INFORMATION: Spec
 Preparation: _____ ☐
 Deck Type: _____ ☐
 Priming: Complete ☐
 Wood Blocking: _____ ☐
 Cant: _____ Vapor Retarder: _____ ☐
 Insulation Type: _____ Thickness: _____ " ☐
 Attachment: _____ ☐
 Second Layer Type: _____ Thickness: _____ " ☐
 Attachment: _____ ☐
 Daily Waterstop: Power Ply ☐
 Roof System: Power Ply ☐

CONTRACTOR INFORMATION:
 Name: Mike Kibithen Roofing
 Contact: Bob Law
 Foreman: Steve Brown, Floyd
 Crew Size: 27
 Office Telephone: 215-533-1118
 Other: _____
 Rep: Rob Hamersky

Flashings: M.B ☐
 Perimeter: 1 ☐
 Walls: 1 ☐
 Curbs: 1 ☐
 Pitch Pans: Lead-Puma ☐
 Tie-ins: Complete ☐
 Interply Matl. Rate: 2 gals/sq Flood Coat: _____ gals/sq
 Kettle Temp.: N/A a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

Roof 2-3 by Vent Curbs were raised to achieve 8" from Deck. Fiber cant was installed and Curb reflash with Power Ply. All seams heat welded per Spec. All Fans and Vents removed from Curbs and vacuumed. This will be done on all roof levels. On Gym Roof 2 Vents raised same as above, 1 flushed. On Roofs: 4-6-9 Drains in walls, dried primed and Banded, all seams (vertical), covered with the mesh.

At a meeting with New Road Construction on maint. was informed by Bob, if he found any screws on roof, roof would have to be patched.

Contractor: [Signature] Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative
 Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11.16.17 # of Days Worked 37 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ NoProject Name: Pinelands Regional SchoolLocation: Little Egg Harbour N.J.

Roof Designation: _____

Weather: RAIN to clouds 52°Owner Rep: Bob SimminoTelephone: 609.457.5998

Present at Site: _____

Start Time: 7:00 Stop Time: _____

CONTRACTOR INFORMATION:

Name: Mike Kobithin RoofingContact: Bob LawForeman: FLOYDCrew Size: 8Office Telephone: 2

Other: _____

Rep: Rob Harnesky

ROOFING SYSTEM INFORMATION: Spec

Preparation: _____ ☐Deck Type: _____ ☐Priming: _____ ☐Wood Blocking: Complete ☐Cant: _____ Vapor Retarder: _____ ☐Insulation Type: _____ Thickness: _____" ☐Attachment: _____ ☐Second Layer Type: _____ Thickness: _____" ☐Attachment: _____ ☐Daily Waterstop: Complete ☐Roof System: Power Ply ☐Flashings: M.B. ☐Perimeter: " ☐Walls: " ☐Curbs: " ☐Pitch Pans: Lead - Puma ☐Tie-ins: Complete ☐Interply Matl. Rate: 2.5 gals/sq Flood Coat: _____ gals/sqKettle Temp.: 12/17 a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

Roof 3: Flashing on Chimney cut, Missing Cant Installed and re flashed! Aluminum sleeper INSTALLED in AREA 10x4 New Power Ply roof INSTALLING under neath of Steam vents. Soil Stacks are Plastic, And have to be raised, Existing Stacks Cleaned, Adapter Added along with new Pipe, to meet Architects spec. 12" Metal Edging on lower Atrium. an CATATERIA

Contractor: [Signature]Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11-17-17 # of Days Worked 38 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: PINELANDS REGIONAL H.S.

Location: Little Egg Harbor N.J.

Roof Designation: 2-3-4-6-12

Weather: Cal 50° Windy

Owner Rep: Bob Simmino

Telephone: 609-457-5998

Present at Site: Bob Simmino & Wagner

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobuthin Roofing

Contact: Bob Law

Foreman: Steve Brown, Floyd

Crew Size: 27

Office Telephone: 533-1118

Other:

Rep: Rob Hamersky

ROOFING SYSTEM INFORMATION: Spec

Preparation: ☐Deck Type: ☐Priming: ☐Wood Blocking: ☐Cant: ☐Insulation Type: ☐Attachment: ☐Second Layer Type: ☐Attachment: ☐Daily Waterstop: ☐Roof System: ☐Flashings: M.B. ☐Perimeter: 11 ☐Walls: 1 ☐Curbs: ☐Pitch Pans: Lead - Puma ☐Tie-ins: Power Ply ☐Interply Matl. Rate: 2.5 gals/sq Flood Coat: ☐

Kettle Temp.: N/A a.m. / at p.m.

Daily Activity and General Notes:

Yesterday, Bob Simmino and myself walked roofs. I mark several AREAS where water ~~was~~ is ponding. After checking to day AREAS were dry. Today we walk top Roof, Science Roof and Roof Area 3. Apparently Brooks Garrison is concerned with AREAS that are showing Pop Corn, an Alligator, or Stretch marks. Terri Flowers was on site last month and ok'd this material. Have metal crew remove 1 length of face metal. Wood nailer cut back and length reinstalled. Replacing Counters to Flash and Raise Pipe. Off an Flash Pipes, Turn Bar SKYLITES

Contractor:

Inspector: Jim J. J.

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11-18-17 # of Days Worked 39 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pinelands Regional School District

Location: Little Egg Harbor N.J.

Roof Designation: ALL

Weather: Cloudy, Storm Expected late

Owner Rep: Bob Simmon

Telephone: 609-457-5998

Present at Site: Bob Simmon

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kohn in Roofing

Contact: Bob Law

Foreman: Steve Brown, Floyd

Crew Size: 19

Office Telephone: 533-1118

Other:

Rep: Rob Hamesky

ROOFING SYSTEM INFORMATION: Spec

Preparation: ☐Deck Type: ☐Priming: Complete ☐Wood Blocking: ☐Cant: Vapor Retarder: ☐Insulation Type: Thickness: " ☐Attachment: ☐Second Layer Type: Thickness: " ☐Attachment: ☐Daily Waterstop: Complete ☐Roof System: Power Ply ☐Flashings: M.B. ☐Perimeter: 1 ☐Walls: 1 ☐Curbs: 1 ☐Pitch Pans: Low Pans ☐Tie-ins: Complete ☐

Interply Matl. Rate: 2 gals/sq Flood Coat: gals/sq

Kettle Temp.: 121 a.m. / at p.m.

Daily Activity and General Notes:

Roofers continue to Turn Bar Flashings
 Tens tape used on Top, and Caulking on Top. Bob Simmon
 An myself Inspect wall 1 and mark several areas to be
 Caulked, Foreman makes necessary repairs. 3 Roofers
 Work on Flashing Soil Stacks. Metal Crew install the
 Panel Detail with Inverted channel, J-Channel on walls
 1 and 3 All metal Edge Installed, except where Wall
 Panels go. Wall Panels to be started on Man. Brooks Garrison
 stops work on Wall Channels. Says J Channel pitched "4"
 toward building. Foreman says weeps go in?

Contractor: [Signature]

Inspector: [Signature]

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

Recommend to roofers High
 winds coming. Secure every
 thing on Roofs. An Grounds.

Boiler Vents were Secured

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11-20-17 # of Days Worked 40 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pine lands Regional School Dist

Location: Little Egg Harbor, N.J.

Roof Designation: ALL

Weather: Sun - 48°

Owner Rep: Bob Simmino

Telephone: 609-437-5998

Present at Site: Mike Kobithen, Bob Simmino

Start Time: 7.00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobithen Roofing

Contact: Bob Law

Foreman: Steve Brown, Floyd

Crew Size: 201 215-533-3181

Office Telephone:

Other:

Rep: Rob Hamerski

ROOFING SYSTEM INFORMATION:

Spec

Preparation: ☐Deck Type: ☐Priming: ☐Wood Blocking: ☐Cant: ☐Insulation Type: ☐Attachment: ☐Second Layer Type: ☐Attachment: ☐Daily Waterstop: Complete ☐Roof System: Power Pla ☐Flashings: M.B. ☐Perimeter: 11 ☐Walls: 11 ☐Curbs: 11 ☐Pitch Pans: LEAD - Puma ☐Tie-ins: Complete ☐Interply Matl. Rate: 2.5 gals/sq Flood Coat: ☐

Kettle Temp.: N/A a.m. / at p.m.

Daily Activity and General Notes:

New Roofs, Bob Simmino, and myself walk all Roof Levels to see what has to be completed. Meeting on Tues! All Laps on field seams complete. I probe everything. Turn bar is being completed around all large SKY Lites on 3rd floor Roof in Sciences AREA. Counter Flashing on Slip metal work continues. Metal Panels still on Hold till they work out the J-Channel issues.

Contractor: SCB

Inspector: Jan

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11.21.17 # of Days Worked 41 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pine lands Regional School Dist

Location: Little Egg Harbour, N.J.

Roof Designation: All

Weather: High of 58 predicted

Owner Rep: Bob Simmno

Telephone: 609.457.5998

Present at Site: Bob Hamersky, M. Kobithen

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kobithen Roofing

Contact: Bob Law

Foreman: Steve Brown - Floyd

Crew Size: 6

Office Telephone: 205.533-3181

Other:

Rep: Bob Hamersky

ROOFING SYSTEM INFORMATION:

Spec

Preparation: ☐Deck Type: Complete ☐Priming: ☐Wood Blocking: ☐Cant: Vapor Retarder: ☐Insulation Type: Thickness: " ☐Attachment: ☐Second Layer Type: Thickness: " ☐Attachment: ☐Daily Waterstop: Complete ☐Roof System: Power Ply ☐Flashings: M.B. ☐Perimeter: " ☐Walls: " ☐Curbs: " ☐Pitch Pans: Lead-Pumca ☐Tie-ins: Complete ☐

Interply Matl. Rate: 2 gals/sq Flood Coat: gals/sq

Kettle Temp.: N/A a.m. / at p.m.

Daily Activity and General Notes:

Job winding down. Roofers have 1/2 off
Go from 20 some people to 6. Boiler Company on site to
finally secure steam pipes on Science wing roof. Roofers
complete turn bar detail on roof (science). Rob Hamersky
and I walk 3rd floor roof to re-inspect the cap.

Areater Brooke is not accepting the material due to
pop corn effect on cap. Basically waiting on Exp. Joint
Metal and ins., Pitch Pockets, and waiting to hear result
of J Channel so we can start that again. Kids
will be returning to school after the holidays. There will

Contractor:

Inspector:

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES
WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE
REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN
THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

be work when kids are in
the school.

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047
 PROJECT INFORMATION:
 Date: 11/24/17 # of Days Worked 42 of _____
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Pine Lands Regional School Dist.
 Location: Little egg Harbour, N.J.
 Roof Designation: ALL
 Weather: 540 HIGH 23° LOW
 Owner Rep: Bob Simmino
 Telephone: 609.457.5998
 Present at Site: Simmino, Kobothin, Alex
 Start Time: 7:00 Stop Time: _____

ROOFING SYSTEM INFORMATION: Spec
 Preparation: _____ ☐
 Deck Type: _____ ☐
 Priming: COMPLETE ☐
 Wood Blocking: _____ ☐
 Cant: _____ Vapor Retarder: _____ ☐
 Insulation Type: _____ Thickness: _____" ☐
 Attachment: _____ ☐
 Second Layer Type: _____ Thickness: _____" ☐
 Attachment: _____ ☐
 Daily Waterstop: _____ ☐
 Roof System: Power Ply ☐

CONTRACTOR INFORMATION:

Name: Mike Kobothin Roofing
 Contact: Bob Law
 Foreman: Steve Brown, Floyd
 Crew Size: 10
 Office Telephone: 215.533.3181
 Other: _____
 Rep: Bob Hammersky

Flashings: MB ☐
 Perimeter: " ☐
 Walls: " ☐
 Curbs: " ☐
 Pitch Pans: LEAD, Puma ☐
 Tie-ins: Complete ☐
 Interply Matl. Rate: 2 gals/sq Flood Coat: _____ gals/sq
 Kettle Temp.: N/A a.m. / _____ at _____ p.m.

Daily Activity and General Notes:

with Panels detail stopped last week,
issue with J. Channel Resolved! Workers complete wall 1
And Start on wall 3. Nothing changed since 1st shut down
flat track mech. FASTENED to metal studs. Approved INSO
Installed between flat track. PANEL FASTENED TO flat
TRACK. Roofing on 3rd floor complete Turn BAR on SKYLITES,
Material pulled back and caulked, Turn bar FASTENED
Every 8", then Caulked.

Contractor: _____

Inspector: Jim Hammersky

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative
 Form 6131 Rev. 1/06

11/27/17

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047
 PROJECT INFORMATION:
 Date: 11.28.17 # of Days Worked 43 of
 Is This Full-time Inspection? ☒ Yes ☐ No
 Are Inspection Days Complete? ☐ Yes ☒ No
 Project Name: Pinelands Regional Schools
 Location: Little Egg Harbor, N.J.
 Roof Designation: All
 Weather: 37° to 59°
 Owner Rep: Bob Jimmario
 Telephone: 609-457-5998
 Present at Site: Mike Kibithen
 Start Time: 7:00 Stop Time:

ROOFING SYSTEM INFORMATION: Spec
 Preparation: ☐
 Deck Type: Comp Lk ☐
 Priming: ☐
 Wood Blocking: ☐
 Cant: ☐ Vapor Retarder: ☐
 Insulation Type: ☐ Thickness: ☐
 Attachment: ☐
 Second Layer Type: ☐ Thickness: ☐
 Attachment: ☐
 Daily Waterstop: Complete ☐
 Roof System: Power Ply ☐

CONTRACTOR INFORMATION:

Name: Mike Kibithen Roofing
 Contact: Bob Law
 Foreman: Steve Brown, Floyd
 Crew Size: 12
 Office Telephone: 215-533-3181
 Other:
 Rep: Rob Hamerski

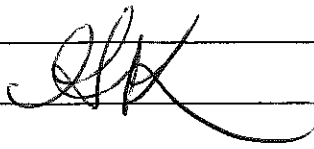
Flashings: M. 10 ☐
 Perimeter: 11 ☐
 Walls: 11 ☐
 Curbs: 11 ☐
 Pitch Pans: LEAD & Puma ☐
 Tie-ins: Complete ☐
 Interply Matl. Rate: 2 gals/sq Flood Coat: ☐ gals/sq
 Kettle Temp.: N/A a.m. / ☐ at ☐ p.m.

Daily Activity and General Notes:

Did not work on SAT. called Mike Jones for Replacement. At the end of today wall Panels have been Installed on Walls, 1, 3, 2.

Roofers on Area 1, working on Caulking Top of Turn Bar on All Skylites. Existing Counter Flashing Screwed down on Corners Repaired. 2 roofers install slip Flashing to 5 Lg. H.V.H. C. unit and numerous curbs. Carpenters install the J channels and Closure Metal ahead of Metal Men on Roof 12-13. Hope to have wall Panels completed by, or Wed. days end

Contractor:



Inspector:



PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
 Pink - Owner Gold - Tremco Representative

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11/28/17 # of Days Worked 44 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pinelands Regional School

Location: Little Egg Harbor, N.J.

Roof Designation: All

Weather: 29 to 59°

Owner Rep: Bob Summario

Telephone: 609.457.5998

Present at Site:

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Mike Kibithen Roofing

Contact: Bob Lann

Foreman: Steve Brown, Floyd

Crew Size: 12

Office Telephone: 215.533.3181

Other:

Rep: Rob Hamersky

ROOFING SYSTEM INFORMATION:

Preparation: Complete ☐Deck Type: ☐Priming: ☐Wood Blocking: ☐Cant: Vapor Retarder: ☐Insulation Type: Thickness: " ☐Attachment: ☐Second Layer Type: Thickness: " ☐Attachment: ☐Daily Waterstop: Complete ☐Roof System: Power ply ☐Flashings: MB ☐Perimeter: " ☐Walls: " ☐Curbs: " ☐Pitch Pans: Lead-Pans ☐Tie-ins: Complete ☐

Interply Matl. Rate: 2.5 gals/sq Flood Coat: gals/sq

Kettle Temp.: N/A a.m. / at p.m.

Daily Activity and General Notes:

On Top Roof, Turn Bar and caulking is complete. Curbs which don't require curb adapters were completed. Roofers move to Science Wing and start the Slip Flashings.

Metal workers complete panel work on Roof #1, 12 &

13. Metal sent out and a template was made to start production of Curb Adapters

Contractor:



Inspector:



PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

11-29-17

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 11-26-17 # of Days Worked 45 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pinelands Regional School

Location: Little Egg Harbor N.J.

Roof Designation: All

Weather: 50° 60°

Owner Rep: Bob Simmiad

Telephone: 609-457-5998

Present at Site: Bob Simmiad

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Kibithen Roofing

Contact: Bob Law

Foreman: Floyd, Steve Brown

Crew Size: 13

Office Telephone: 215-533-3181

Other:

Rep: Rob Hamersky

ROOFING SYSTEM INFORMATION: Spec

Preparation: Complete ☐Deck Type: ☐Priming: ☐Wood Blocking: ☐Cant: Vapor Retarder: ☐Insulation Type: Thickness: " ☐Attachment: ☐Second Layer Type: Thickness: " ☐Attachment: ☐Daily Waterstop: Complete ☐Roof System: Power Ply ☐Flashings: MB ☐Perimeter: 1" ☐Walls: 1" ☐Curbs: 1" ☐Pitch Pans: Lead - Puma ☐Tie-ins: Complete ☐

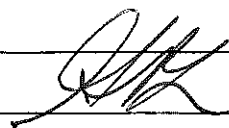
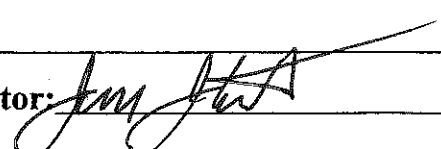
Interply Matl. Rate: 25 gals/sq Flood Coat: gals/sq

Kettle Temp.: N/A a.m. / at p.m.

Daily Activity and General Notes:

Work Continues on Atrium Roof, 2 Skylites turnbar. Caulk Placed Between Substrate and Power Ply. Turnbar Mech. Attached every 8" Counter Flashing (EXISTING) bent back down. Corners Caulked and Refastened where needed.

On All Curbs, where Flashing Material was not brought up an over-slip Flashings are being installed. Where curbs Flashing are up and over no slip Flashing needed.

Contractor: Inspector: 

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

11/30/17
WORK ORDER #: 9492047
PROJECT INFORMATION:
Date: 11.27.17 # of Days Worked 46 of
Is This Full-time Inspection? ☒ Yes ☐ No
Are Inspection Days Complete? ☐ Yes ☒ No
Project Name: Pine Lands Regional School Dist.
Location: Little Egg Harbor
Roof Designation: ALL
Weather: 50°s
Owner Rep: Bob Simmino
Telephone: 609-457-5998
Present at Site:
Start Time: 7.00 Stop Time:

WTI DAILY FIELD REPORT

ROOFING SYSTEM INFORMATION: Spec
Preparation: ☐
Deck Type: ☐
Priming: ☐
Wood Blocking: ☐
Cant: ☐ Vapor Retarder: ☐
Insulation Type: ☐ Thickness: ☐
Attachment: ☐
Second Layer Type: ☐ Thickness: ☐
Attachment: ☐
Daily Waterstop: ☐
Roof System: ☐

CONTRACTOR INFORMATION:
Name: Kibithin Roofing
Contact: Bob Law
Foreman: FLOYD, Steve BROWN
Crew Size: 14
Office Telephone: 215-523-3121
Other:
Rep: Rob Hamersky

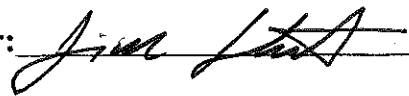
Flashings: ☐
Perimeter: ☐
Walls: ☐
Curbs: ☐
Pitch Pans: ☐
Tie-ins: ☐
Interply Matl. Rate: 2.5 gals/sq Flood Coat: ☐ gals/sq
Kettle Temp.: N/A a.m. / ☐ at ☐ p.m.

Daily Activity and General Notes:

started punch list, Roofs are not complete yet. Will go back over roofs when done. A Separate Punch list sheet will be included in checklists on A Copy to roofing Company. Turn bar, counter flashing, has been completed on Roof 1-2-3-4-6 as well as slip flashings.

Brooks Garrison Architect, Rob Hamersky and rep. from Cleveland will be on site tomorrow to examine all roofs to assess the blue berry pop corn problems

Contractor: 

Inspector: 

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies Yellow - Contractor
Pink - Owner Gold - Tremco Representative

12.1.17

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: ~~11/17/17~~ # of Days Worked 47 ofIs This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pine lands Regional School

Location: Little Egg Harbour N.J.

Roof Designation: ALL

Weather: 50°

Owner Rep: Bob Simmino

Telephone: 609-457-5998

Present at Site: List Below

Start Time: 7:00 Stop Time:

CONTRACTOR INFORMATION:

Name: Kibithen Roofing

Contact: Bob Law

Foreman: Floyd, Steve Brown

Crew Size: 14

Office Telephone: 215 533-3281

Other:

Rep: Bob Hammersky

ROOFING SYSTEM INFORMATION:

Spec

Preparation: Remove ☐Deck Type: Metal ☐Priming: ☐Wood Blocking: Complete ☐Cant: Vapor Retarder: ☐Insulation Type: Thickness: " ☐Attachment: ☐Second Layer Type: Thickness: " ☐Attachment: Complete ☐Daily Waterstop: ☐Roof System: Power Ply ☐Flashings: MB ☐Perimeter: " ☐Walls: " ☐Curbs: " ☐Pitch Pans: LEAD, Puma ☐Tie-ins: Complete ☐

Interply Matl. Rate: 2.5 gals/sq Flood Coat: gals/sq

Kettle Temp.: N at 4 a.m. / at p.m.

Daily Activity and General Notes:

Today walk the roof with Rob Hammersky, from Cleveland, John Hansen, Robert Mauro, Roofing Company Mike and Mike Jr. Kibithin, Alex, Bob Law. Brooks Garrison and Bob Simmino representing School. Meeting was to walk every roof to see if the pop corning is appearing on all roofs. Defect was found on 3rd Floor Roof. And starting to appear on Auditorium Roof. John Hansen and Mauro also took pictures and documented approx 15 different areas needed to be repaired. They will put together a punch list and forward to all parties so roofers can repair.

Contractor:

Inspector: Jim Hama

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06

WTI DAILY FIELD REPORT

WORK ORDER #: 9492047

PROJECT INFORMATION:

Date: 12.4.17 # of Days Worked 48 of

Is This Full-time Inspection? ☒ Yes ☐ NoAre Inspection Days Complete? ☐ Yes ☒ No

Project Name: Pine lands Regional

Location: Little Egg Harbour N.S

Roof Designation: ALL

Weather: 50°

Owner Rep: Bob Simmion

Telephone: 609.457.5988

Present at Site: Bob Simmion

Start Time: 7.00 Stop Time:

CONTRACTOR INFORMATION:

Name: Kobithen Roofing

Contact: Bob Law

Foreman: Floyd, Steve Braun

Crew Size: 4

Office Telephone: 215.533.3181

Other:

Rep: Rob Hamarski

ROOFING SYSTEM INFORMATION:

Spec

Preparation: ☐Deck Type: ☐Priming: Complete ☐Wood Blocking: ☐Cant: ☐ Vapor Retarder: ☐Insulation Type: ☐ Thickness: " ☐Attachment: ☐Second Layer Type: ☐ Thickness: " ☐Attachment: ☐Daily Waterstop: Complete ☐Roof System: Power Ply ☐Flashings: M.B. ☐Perimeter: 11 ☐Walls: 11 ☐Curbs: 11 ☐Pitch Pans: Lead ☐Tie-ins: Complete ☐Interply Matl. Rate: 2.5 gals/sq Flood Coat: ☐ gals/sqKettle Temp.: 1/2 at 10 a.m. / ☐ at ☐ p.m.

Daily Activity and General Notes:

Curbs on Science Wing, Atrium Roof, and 2nd Area Roofs. All curbs removed and inspected to see if Flashing Material was brought up and nailed to top of curb. If NOT, these curbs will be being completed using a S.S. Slip Flashing or Aluminum. Above Roof have been completed. I punch out as we go. Wall 10 has been completed with the Panels. Where Panels meet brick walls, End Closure's are being installed. Securing to bricks that will be removed next year. On Atrium wall and wall 10 bricks are damaged and missing.

Contractor:

Inspector: Jim J...

PLEASE NOTE THAT YOUR SAFETY COORDINATOR SHOULD REVIEW SAFETY REQUIREMENTS AND PROCEDURES WITH THE FOREMAN AND CREW ON THIS PROJECT. THIS IS A CONTRACTOR RESPONSIBILITY AND SHOULD BE REINFORCED REGULARLY. TREMCO IS NOT, HOWEVER, QUALIFIED TO PROVIDE ASSISTANCE OR ADVISE IN THIS AREA.

White - Weatherproofing Technologies

Yellow - Contractor

Pink - Owner

Gold - Tremco Representative

Form 6131 Rev. 1/06