

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Inspection and Testing Form - Fire Alarm - Fail

Devices	Tested this Inspection	Pass	Fail	Tested YTD	Not Tested YTD	Total
Horn Strobe	2	2	0	2	0	2
Smoke Detector	3	3	0	3	0	3
Heat Detector	7	1	6	7	0	7
Pull Station	3	3	0	3	0	3

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Monitoring Entity

Contact Name	Carlstadt PD	Type Transmission	Starlink
--------------	--------------	-------------------	----------

Approving Agency

Contact Name	N/A	Telephone	N/A
Email	N/A	Service Type	N/A

System Type

Control Unit Manufacturer	DMP	Model Number	XR150FC
Circuit Styles	N/A	Software Revision	N/A
Date Last Serviced	2022-04-29	Last Date and Software or Configuration was Revised	N/A

Power Supply

Main Nominal Voltage	120VAC	Main Nominal Amps	N/A
Overcurrent Protection	N/A	Panel Board Location	N/A
Disconnecting Means Location	N/A	Secondary Standby	N/A
Storage Battery: Amp Hour Rating	7AH	Calculated Capacity to operate system (Hours)	N/A
Engine-driven generator dedicated to fire alarm system	N/A	Location of fuel storage	N/A
Has Emergency System described in NFPA 70, Article 700	N/A	Has Legally required standby described in NFPA 70, Article 701	N/A
Has Optional standby system described in NFPA 70, Article 702, which also meets the performance requirements of Article 700 or 701	N/A		

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



NOTIFICATIONS MADE PRIOR TO ANY TESTING		Yes	No	N/A	Who	Time
Building Occupants		☒	☐	☐		
AHJ Notified of Any Impairments		☐	☐	☒		
Other (Specify)		☐	☐	☒		
Building Management		☒	☐	☐		
Monitoring Entity		☒	☐	☐	Carlstadt PD	
SYSTEM TESTS AND INSPECTIONS	Visual	Functional	Pass/Fail	Comments		
Reset/Power down Test	Yes	Yes	Pass			
Lamps/LEDS	Yes	Yes	Pass			
MNS to direct recipient MNS	N/A	N/A	N/A			
Functional Test	Yes	Yes	Pass			
Software Backup Performed	N/A	N/A	N/A			
System Intelligibility - STI	N/A	N/A	N/A			
In-building MNS to wide area MNS	N/A	N/A	N/A			
Trouble Signals	Yes	Yes	Pass			
Fire Alarm to MNS Interface	N/A	N/A	N/A			
Ground-Fault Monitoring	N/A	N/A	N/A			
CCU Security Mechanism	N/A	N/A	N/A			
Power Extender Panels	N/A	N/A	N/A			
Control Unit	Yes	Yes	Pass			
Prerecorded Message Content	N/A	N/A	N/A			
Local Annunciator	Yes	Yes	Pass			
Supervision	N/A	N/A	N/A			
Disconnect Switches	N/A	N/A	N/A			
Primary Power Supply	Yes	Yes	Pass			
Isolation Modules	N/A	N/A	N/A			
Fuses	N/A	N/A	N/A			
Sound Pressure Level- Alarm	N/A	N/A	N/A			
Interface Equipment	N/A	N/A	N/A			

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League
9th ST
Carlstadt NJ 07072
Paul 2018036317
Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety
P00111
509 Washington Ave
Carlstadt NJ 07072
201-635-0400
reports@metrofire.com



Other (Specify)	N/A	N/A	N/A	
Prerecorded Message Activation	N/A	N/A	N/A	
Remote Annunciator	N/A	N/A	N/A	
MNS to Fire Alarm Interface	N/A	N/A	N/A	
System Intelligibility - CSI	N/A	N/A	N/A	
UPS Power Test	N/A	N/A	N/A	
Sound Pressure Level- Ambient	N/A	N/A	N/A	
Test Backup Software	N/A	N/A	N/A	
SECONDARY POWER	Visual	Functional	Pass/Fail	Comments
Transient Suppressors	N/A	N/A	N/A	
Discharge Test	Yes	Yes	Pass	
Battery Condition	Yes	Yes	Pass	
Load Voltage	Yes	Yes	Pass	
Charger Test	N/A	N/A	N/A	
Remote Annunciators	N/A	N/A	N/A	
NOTIFICATION APPLIANCES	Visual	Functional	Pass/Fail	Comments
Voice Clarity	N/A	N/A	N/A	
Visual	Yes	Yes	Pass	
Audible	Yes	Yes	Pass	
Speakers	N/A	N/A	N/A	
EMERGENCY COMMUNICATION EQUIPMENT	Visual	Functional	Pass/Fail	Comments
Off-Hook Indicator	N/A	N/A	N/A	
System Intelligibility	N/A	N/A	N/A	
Phone Jacks	N/A	N/A	N/A	
System Audibility	N/A	N/A	N/A	
Phone Set	N/A	N/A	N/A	
Amplifier(s)	N/A	N/A	N/A	
Other (Specify)	N/A	N/A	N/A	

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Area of Refuge Communication System	N/A	N/A	N/A	
Tone Generator(s)	N/A	N/A	N/A	
Elevator Emergency Communication System	N/A	N/A	N/A	
Radio Communication Enhancement System	N/A	N/A	N/A	
System Performance	N/A	N/A	N/A	
Call-in Signal	N/A	N/A	N/A	
AUXILIARY FUNCTIONS/INTERFACE EQUIPMENT/SPECIAL HAZARDS	Visual	Functional	Pass/Fail	Comments
Other (Specify)	N/A	N/A	N/A	
Smoke Management/Smoke Control	N/A	N/A	N/A	
Door Unlocking	N/A	N/A	N/A	
Smoke Shutter Release	N/A	N/A	N/A	
Elevator Recall	N/A	N/A	N/A	
Elevator Shunt-Trip	N/A	N/A	N/A	
MNS Override of FA signals	N/A	N/A	N/A	
Smoke Damper Operation	N/A	N/A	N/A	
Door-Releasing Devices	N/A	N/A	N/A	
Fan Shutdown	N/A	N/A	N/A	

SUPERVISING STATION MONITORING	Yes	No	N/A	Who	Time
Alarm Restoration	☐	☐	☒		
Supervisory Restoration	☐	☐	☒		
Trouble Restoral	☐	☐	☒		
Trouble Signals	☐	☐	☒		
Supervisory Signal	☐	☐	☒		
Alarm Signal	☐	☐	☒		

NOTIFICATIONS THAT TESTING IS COMPLETE	Yes	No	N/A	Who	Time
Building Management	☒	☐	☐		
AHJ Notified of Any Impairments	☐	☐	☒		
Monitoring Agency	☒	☐	☐	Carlstadt PD	

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Other (Specify)	☐	☐	☒		
Building Occupants	☒	☐	☐		

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



INITIATING, SUPERVISORY, AND NOTIFICATION DEVICE TESTS AND INSPECTIONS

Address	Location	Device Type	Factory Setting	Measured Setting	Visual	Functional	Pass/Fail
	Outside	Horn Strobe			Yes	Yes	Pass (2022-04-29)
	By bathrooms	Pull Station			Yes	Yes	Pass (2022-04-29)
	Men's room	Heat Detector			Yes	No	Fail (2022-04-29)
	Women's room	Heat Detector			Yes	No	Fail (2022-04-29)
	By FACP	Smoke Detector			Yes	Yes	Pass (2022-04-29)
	Hall by kitchen	Smoke Detector			Yes	Yes	Pass (2022-04-29)
	Bottom of stairs	Horn Strobe			Yes	Yes	Pass (2022-04-29)
	Kitchen	Heat Detector			Yes	No	Fail (2022-04-29)
	Kitchen	Pull Station			Yes	Yes	Pass (2022-04-29)
	Kitchen	Heat Detector			Yes	No	Fail (2022-04-29)
	Top of stairs	Smoke Detector			Yes	Yes	Pass (2022-04-29)
	Upstairs	Heat Detector			Yes	No	Fail (2022-04-29)
	Upstairs	Pull Station			Yes	Yes	Pass (2022-04-29)
	Upstairs	Heat Detector			Yes	No	Fail (2022-04-29)
	Basement	Heat Detector			Yes	Yes	Pass (2022-04-29)

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Control Panel and Battery Readings

Location: Utility room				
Manufacturer: DMP				
Model: XR150FC				
AC Power Supply Volts AC	DC Power Supply Volts DC	Load Test %	Battery w/Charger	Battery w/Out Charger
120VAC	24VDC			
Battery Date	AC Loss Causes Trouble	DC Loss Causes Trouble	Battery Voltage & AH Rating	Ground Fault
	Yes	Yes	12V 7AH	
Battery Voltage AH Rating	Battery Voltage AH Rating w/Charger	Battery Voltage AH Rating w/Out Charger	Battery Voltage & AH Rating Under Load	
12V 7AH				
Second Battery				
AC Power Supply Volts AC	DC Power Supply Volts DC	Load Test %	Battery w/Charger	Battery w/Out Charger
Battery Date	AC Loss Causes Trouble	DC Loss Causes Trouble	Battery Voltage & AH Rating	
	Yes	Yes	12V 7AH	
Battery Voltage AH Rating	Battery Voltage AH Rating w/Charger	Battery Voltage AH Rating w/Out Charger	Battery Voltage & AH Rating Under Load	
12V 7AH				
Comments				

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Deficiencies - Fire Alarm

Heat Detector - Upstairs -

Status: Fail

Notes:

Device is outdated, must be replaced.



Heat Detector - Upstairs -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Kitchen -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety


P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com

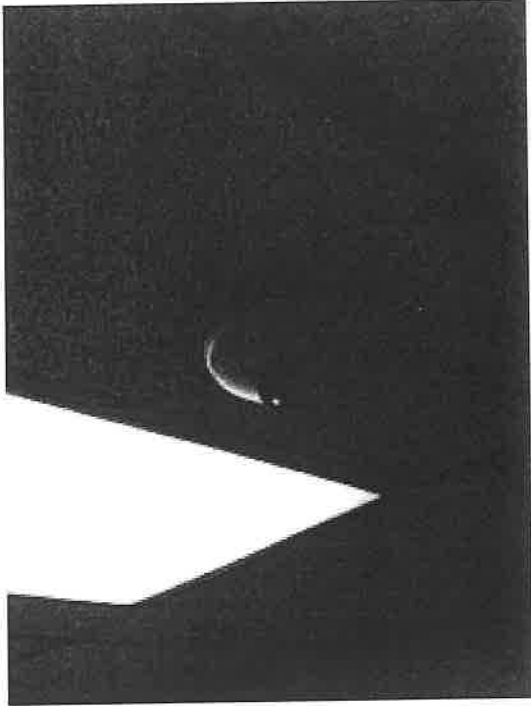

Heat Detector - Kitchen -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Women's room -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Men's room -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt Little League

9th ST

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



PURCHASE ORDER REQUISITION

VENDOR		DEPARTMENT	ACTIVITY	REQ. NO.
METRO FIRE 509 WASHINGTON AVE. CARLSTADT NJ 07072		Buildings & Grounds	OUTSIDE CONTRACTOR	60
		VENDOR NO	P.O. NO.	DATE 5/9/2022

ITEM	QUANTITY	DESCRIPTION	ACCOUNT	COST
1	1	FIRE ALARM INSPECTION	1-018-501- 20-55	395.00
2		FUEL SURCHARGE		5.00
3		DATED 4/30/22 INV.#SM46281		
4		CARLSTADT DPW		
5				
6				
7				
8				
9				
10				
11				
12				
13				
14				
			TOTAL:	\$400.00

MAYOR/COMMISSIONER APPROVAL

5/10/22 

 DATE SIGNATURE

BOROUGH OF CARLSTADT
 500 MADISON STREET
 CARLSTADT, NJ 07072

DEPARTMENTAL CERTIFICATION

5/9/2022

 DATE DEPARTMENT HEAD

CERTIFICATION OF FUNDS

5/10/22 

 DATE SIGNATURE
 CMFO/TREASURER



509 Washington Avenue
Carlstadt, NJ 07072
Phone: (201) 635-0400 - Fax: (201) 635-0410

Invoice #: SM 46281

Invoice Date: 4/30/2022

Completion Date: 4/29/2022

Technician: Toro, Daniel

Bill To: Carlstadt Borough Hall
500 Madison Street
Attn: Paul Richie
Carlstadt, NJ 07072

Service At: Carlstadt D.P.W.
105 Kero Road
Carlstadt, NJ 07072

Division: Alarms - Service/Repair
Description: A-Inspection Needed

PO Number:
Alt #:

Terms: 10 Days
Due Date: 5/10/2022

WO#	Item	Description	Qty	Unit Price	Amount
<u>59047</u>	Service				
		A - Fire Alarm Inspection (1) Ademco 50P fire alarm system	1.00	395.00	395.00
		Note: (23) heat detectors failed			
		A - Fuel Surcharge	1.00	5.00	5.00

The Fire Safety Professionals Since 1962

Subtotal:	400.00
Sales Tax:	0.00
Total Due:	400.00

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Inspection and Testing Form - Fire Alarm - Fail

Devices	Tested this Inspection	Pass	Fail	Tested YTD	Not Tested YTD	Total
Bell	1	0	1	1	0	1
Smoke Detector	1	1	0	1	0	1
Heat Detector	23	0	23	23	0	23
Annunciator	1	1	0	1	0	1

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Approving Agency

Contact Name	N/A	Telephone	N/A
Email	N/A	Service Type	N/A

System Type

Control Unit Manufacturer	Ademco	Model Number	50P
Circuit Styles	N/A	Software Revision	N/A
Date Last Serviced	2022-04-29	Last Date and Software or Configuration was Revised	N/A
Number of Circuits	10		

Power Supply

Main Nominal Voltage	120VAC	Main Nominal Amps	N/A
Overcurrent Protection	N/A	Panel Board Location	N/A
Disconnecting Means Location	N/A	Secondary Standby	N/A
Storage Battery: Amp Hour Rating	7AH	Calculated Capacity to operate system (Hours)	N/A
Engine-driven generator dedicated to fire alarm system	N/A	Location of fuel storage	N/A
Has Emergency System described in NFPA 70, Article 700	N/A	Has Legally required standby described in NFPA 70, Article 701	N/A
Has Optional standby system described in NFPA 70, Article 702, which also meets the performance requirements of Article 700 or 701	N/A		

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.
105 Kero Rd
Carlstadt NJ 07072
Paul 2018036317
Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety
P00111
509 Washington Ave
Carlstadt NJ 07072
201-635-0400
reports@metrofire.com



NOTIFICATIONS MADE PRIOR TO ANY TESTING		Yes	No	N/A	Who	Time
AHJ Notified of Any Impairments		☐	☐	☒		
Monitoring Entity		☒	☐	☐	Supreme Security	
Building Occupants		☒	☐	☐		
Building Management		☒	☐	☐		
Other (Specify)		☒	☐	☐	Carlstadt FD	

SYSTEM TESTS AND INSPECTIONS	Visual	Functional	Pass/Fail	Comments
Control Unit	Yes	Yes	Pass	
Fire Alarm to MNS Interface	N/A	N/A	N/A	
Functional Test	Yes	Yes	Pass	
UPS Power Test	N/A	N/A	N/A	
Lamps/LEDS	Yes	Yes	Pass	
Trouble Signals	Yes	Yes	Pass	
MNS to Fire Alarm Interface	N/A	N/A	N/A	
CCU Security Mechanism	N/A	N/A	N/A	
Disconnect Switches	N/A	N/A	N/A	
Power Extender Panels	N/A	N/A	N/A	
Test Backup Software	N/A	N/A	N/A	
System Intelligibility - STI	N/A	N/A	N/A	
Primary Power Supply	Yes	Yes	Pass	
Interface Equipment	N/A	N/A	N/A	
MNS to direct recipient MNS	N/A	N/A	N/A	
Remote Annunciator	Yes	Yes	Pass	
Reset/Power down Test	Yes	Yes	Pass	
Other (Specify)	N/A	N/A	N/A	
Fuses	N/A	N/A	N/A	
In-building MNS to wide area MNS	N/A	N/A	N/A	
Sound Pressure Level- Ambient	N/A	N/A	N/A	
Sound Pressure Level- Alarm	N/A	N/A	N/A	

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Isolation Modules	N/A	N/A	N/A	
Supervision	N/A	N/A	N/A	
Prerecorded Message Content	N/A	N/A	N/A	
System Intelligibility - CSI	N/A	N/A	N/A	
Local Annunciator	N/A	N/A	N/A	
Ground-Fault Monitoring	N/A	N/A	N/A	
Software Backup Performed	N/A	N/A	N/A	
Prerecorded Message Activation	N/A	N/A	N/A	
SECONDARY POWER	Visual	Functional	Pass/Fail	Comments
Charger Test	N/A	N/A	N/A	
Load Voltage	Yes	Yes		
Battery Condition	Yes	Yes	Pass	
Remote Annunciators	N/A	N/A	N/A	
Transient Suppressors	N/A	N/A	N/A	
Discharge Test	Yes	Yes	Pass	
NOTIFICATION APPLIANCES	Visual	Functional	Pass/Fail	Comments
Speakers	N/A	N/A	N/A	
Audible	Yes	Yes	Failed	Bell did not go off upon alarm.
Visual	Yes	Yes	Failed	Bell did not go off upon alarm.
Voice Clarity	N/A	N/A	N/A	
EMERGENCY COMMUNICATION EQUIPMENT	Visual	Functional	Pass/Fail	Comments
Call-in Signal	N/A	N/A	N/A	
System Performance	N/A	N/A	N/A	
Amplifier(s)	N/A	N/A	N/A	
Off-Hook Indicator	N/A	N/A	N/A	
Area of Refuge Communication System	N/A	N/A	N/A	
Phone Set	N/A	N/A	N/A	
Radio Communication Enhancement System	N/A	N/A	N/A	

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.
105 Kero Rd
Carlstadt NJ 07072
Paul 2018036317
Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety
P00111
509 Washington Ave
Carlstadt NJ 07072
201-635-0400
reports@metrofire.com



Tone Generator(s)	N/A	N/A	N/A		
Phone Jacks	N/A	N/A	N/A		
System Audibility	N/A	N/A	N/A		
Elevator Emergency Communication System	N/A	N/A	N/A		
System Intelligibility	N/A	N/A	N/A		
Other (Specify)	N/A	N/A	N/A		
AUXILIARY FUNCTIONS/INTERFACE EQUIPMENT/SPECIAL HAZARDS	Visual	Functional	Pass/Fail	Comments	
Fan Shutdown	N/A	N/A	N/A		
Door Unlocking	N/A	N/A	N/A		
Smoke Shutter Release	N/A	N/A	N/A		
Smoke Management/Smoke Control	N/A	N/A	N/A		
Door-Releasing Devices	N/A	N/A	N/A		
Other (Specify)	N/A	N/A	N/A		
Elevator Recall	N/A	N/A	N/A		
MNS Override of FA signals	N/A	N/A	N/A		
Smoke Damper Operation	N/A	N/A	N/A		
Elevator Shunt-Trip	N/A	N/A	N/A		
SUPERVISING STATION MONITORING	Yes	No	N/A	Who	Time
Trouble Restoral	☐	☐	☒		
Alarm Restoration	☒	☐	☐	Supreme Security	
Alarm Signal	☒	☐	☐	Supreme Security	
Trouble Signals	☐	☐	☒		
Supervisory Signal	☐	☐	☒		
Supervisory Restoration	☐	☐	☒		
NOTIFICATIONS THAT TESTING IS COMPLETE	Yes	No	N/A	Who	Time
Other (Specify)	☒	☐	☐	Carlstadt FD	
Building Management	☒	☐	☐		
Monitoring Agency	☒	☐	☐	Supreme Security	

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Building Occupants	☒	☐	☐		
AHJ Notified of Any Impairments	☐	☐	☒		

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.
105 Kero Rd
Carlstadt NJ 07072
Paul 2018036317
Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety
P00111
509 Washington Ave
Carlstadt NJ 07072
201-635-0400
reports@metrofire.com



INITIATING, SUPERVISORY, AND NOTIFICATION DEVICE TESTS AND INSPECTIONS

Address	Location	Device Type	Factory Setting	Measured Setting	Visual	Functional	Pass/Fail
	Main entrance	Bell			Yes	Yes	Fail (2022-04-29)
	Break room	Heat Detector			Yes	Yes	Fail (2022-04-29)
	Main office	Heat Detector			Yes	No	Fail (2022-04-29)
	Office next to main office	Heat Detector			Yes	No	Fail (2022-04-29)
	Locker room	Heat Detector			Yes	No	Fail (2022-04-29)
	Locker room	Heat Detector			Yes	No	Fail (2022-04-29)
	Locker room	Heat Detector			Yes	Yes	Fail (2022-04-29)
	Mechanical shop	Heat Detector			Yes	No	Fail (2022-04-29)
	Sign shop	Heat Detector			Yes	No	Fail (2022-04-29)
	Front vestibule	Annunciator			Yes	Yes	Pass (2022-04-29)
	Auto mechanic shop	Heat Detector			Yes	No	Fail (2022-04-29)
	Auto mechanic shop	Heat Detector			Yes	No	Fail (2022-04-29)
	Shop men's room	Heat Detector			Yes	No	Fail (2022-04-29)
	Auto mechanic garage	Heat Detector			Yes	No	Fail (2022-04-29)
	Auto mechanic garage	Heat Detector			Yes	No	Fail (2022-04-29)
	Auto mechanic garage	Heat Detector			Yes	No	Fail (2022-04-29)
	Auto mechanic garage	Heat Detector			Yes	No	Fail (2022-04-29)

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.
105 Kero Rd
Carlstadt NJ 07072
Paul 2018036317
Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety
P00111
509 Washington Ave
Carlstadt NJ 07072
201-635-0400
reports@metrofire.com



Address	Location	Device Type	Factory Setting	Measured Setting	Visual	Functional	Pass/Fail
	Auto mechanic garage	Heat Detector			Yes	No	Fail (2022-04-29)
	Auto mechanic garage	Heat Detector			Yes	No	Fail (2022-04-29)
	Auto mechanic garage	Heat Detector			Yes	No	Fail (2022-04-29)
	Auto mechanic garage	Heat Detector			Yes	No	Fail (2022-04-29)
	Hall by sign shop	Smoke Detector			Yes	Yes	Pass (2022-04-29)
	Men's room by weight room	Heat Detector			Yes	No	Fail (2022-04-29)
	Supply room	Heat Detector			Yes	No	Fail (2022-04-29)
	Ladies's room	Heat Detector			Yes	No	Fail (2022-04-29)
	Ladies' room locker room	Heat Detector			Yes	No	Fail (2022-04-29)

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Control Panel and Battery Readings

Location: Main office				
Manufacturer: Ademco				
Model: 50P				
AC Power Supply Volts AC	DC Power Supply Volts DC	Load Test %	Battery w/Charger	Battery w/Out Charger
120VAC	24VDC			
Battery Date	AC Loss Causes Trouble	DC Loss Causes Trouble	Battery Voltage & AH Rating	Ground Fault
	Yes	Yes	12V 7Ah	
Battery Voltage AH Rating	Battery Voltage AH Rating w/Charger	Battery Voltage AH Rating w/Out Charger	Battery Voltage & AH Rating Under Load	
12V 7Ah				
Comments				
Reset code 1929				

Report of Inspection / Test

Annual NFPA 72-13



2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com

Deficiencies - Fire Alarm

Visual: Failed

Notes:

Bell did not go off upon alarm.

Audible: Failed

Notes:

Bell did not go off upon alarm.

50P - Main office

Battery Pass/Fail: Fail

Secondary Battery Pass/Fail:

Notes:

Bell - Main entrance -

Status: Fail

Notes:

Device did not go off upon alarm.



Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com




Heat Detector - Ladies' room locker room -

Status: Fail

Notes:

Device is outdated, must be replaced.

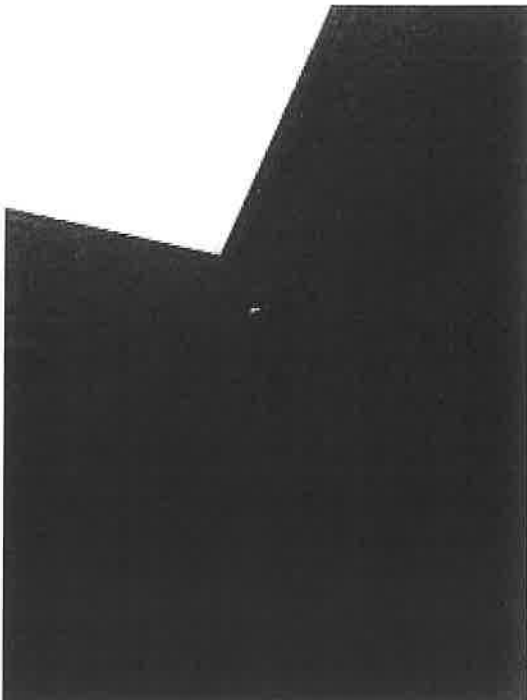

Heat Detector - Ladies's room -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Supply room -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Men's room by weight room -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Auto mechanic garage -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety


P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com

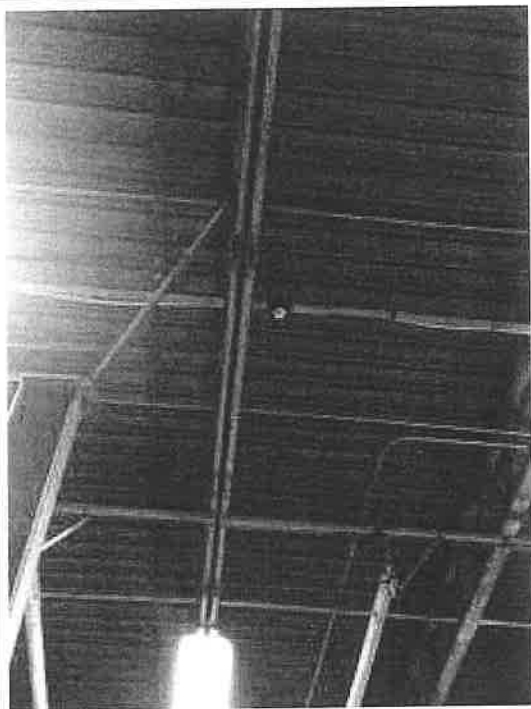

Heat Detector - Auto mechanic garage -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Auto mechanic garage -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety


P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com

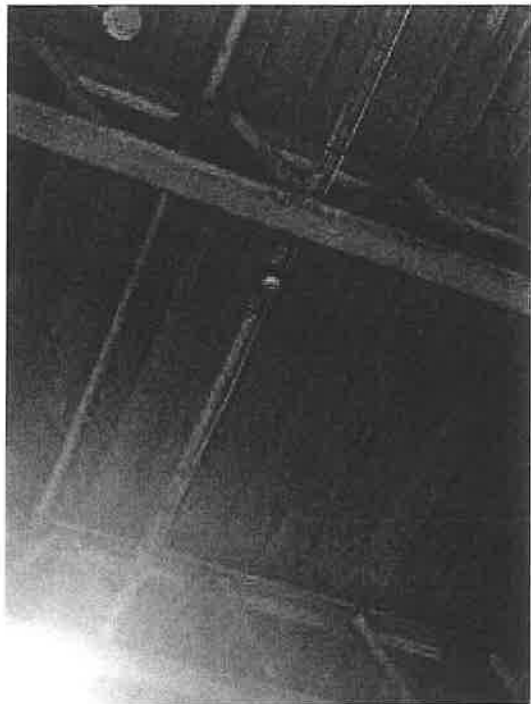

Heat Detector - Auto mechanic garage -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Auto mechanic garage -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Auto mechanic garage -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety


P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com

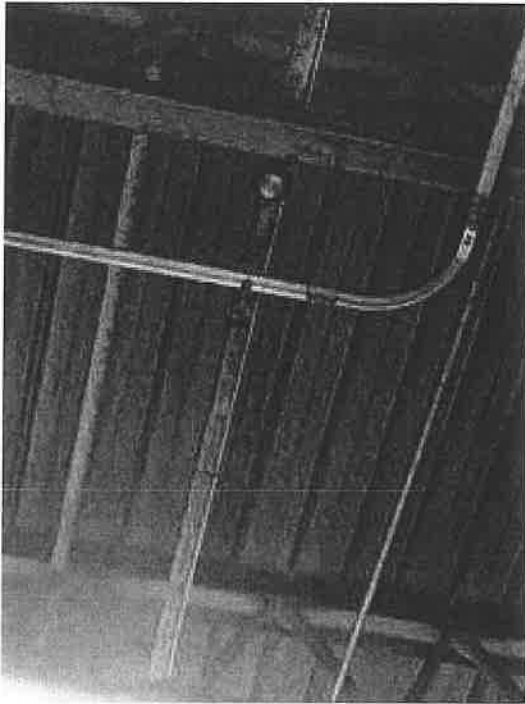

Heat Detector - Auto mechanic garage -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13




2022-04-29

Property

Carlstadt D.P.W.
105 Kero Rd
Carlstadt NJ 07072
Paul 2018036317
Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety
P00111
509 Washington Ave
Carlstadt NJ 07072
201-635-0400
reports@metrofire.com

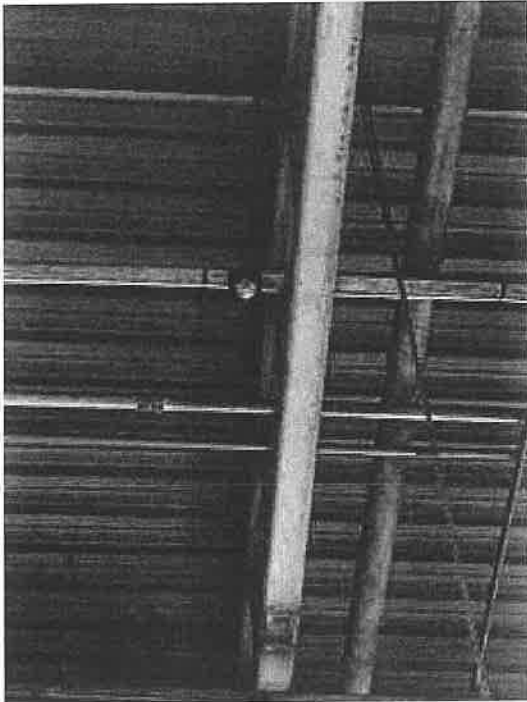

Heat Detector - Auto mechanic garage -

Status: Fail

Notes:

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety


P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com

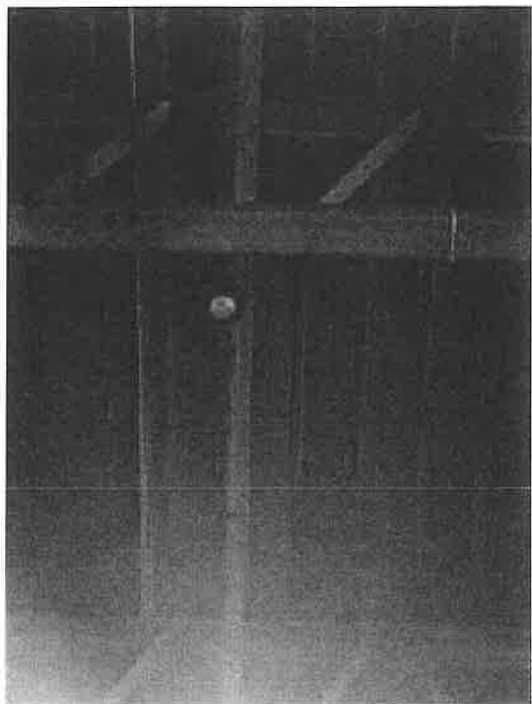

Heat Detector - Shop men's room -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Auto mechanic shop -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Auto mechanic shop -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.
105 Kero Rd
Carlstadt NJ 07072
Paul 2018036317
Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety
P00111
509 Washington Ave
Carlstadt NJ 07072
201-635-0400
reports@metrofire.com



Heat Detector - Sign shop -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Mechanical shop -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Locker room -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Locker room -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety


P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com

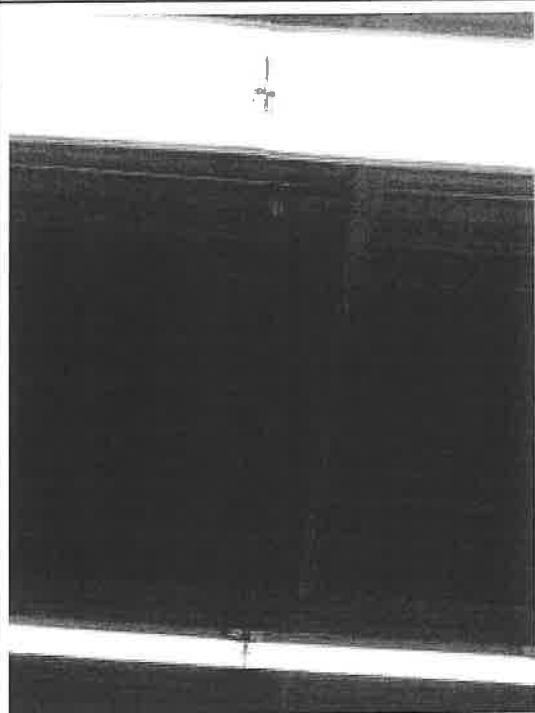

Heat Detector - Locker room -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Office next to main office -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13



2022-04-29

Property

Carlstadt D.P.W.
105 Kero Rd
Carlstadt NJ 07072
Paul 2018036317
Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety
P00111
509 Washington Ave
Carlstadt NJ 07072
201-635-0400
reports@metrofire.com



Heat Detector - Main office -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com



Heat Detector - Break room -

Status: Fail

Notes:

Device is outdated, must be replaced.

Report of Inspection / Test

Annual NFPA 72-13

2022-04-29

Property

Carlstadt D.P.W.

105 Kero Rd

Carlstadt NJ 07072

Paul 2018036317

Print Date: 2022-05-02

Conducted by: Alarm_1

Metro Fire & Safety

P00111

509 Washington Ave

Carlstadt NJ 07072

201-635-0400

reports@metrofire.com

